

CEX-60.6

CIVIL EFFECTS EXERCISE

DISTRIBUTION STATEMENT A
Approved for Public Release
Distribution Unlimited

EXPERIMENTAL EVALUATION OF THE
RADIATION PROTECTION PROVIDED
BY AN EARTH-COVERED SHELTER

Z. Burson and H. Borella

20050916 049

Issuance Date: February 1962

**CIVIL EFFECTS TEST OPERATIONS
U.S. ATOMIC ENERGY COMMISSION**

NOTICE

This report is published in the interest of providing information which may prove of value to the reader in his study of effects data derived principally from nuclear weapons tests and from experiments designed to duplicate various characteristics of nuclear weapons.

This document is based on information available at the time of preparation which may have subsequently been expanded and re-evaluated. Also, in preparing this report for publication, some classified material may have been removed. Users are cautioned to avoid interpretations and conclusions based on unknown or incomplete data.

PRINTED IN USA

**Price \$1.00. Available from the Office of
Technical Services, Department of Commerce,
Washington 25, D. C.**

EXPERIMENTAL EVALUATION OF THE RADIATION PROTECTION PROVIDED BY AN EARTH-COVERED SHELTER

By
Z. Burson and H. Borella

Approved by: R. L. CORSBIE
Director
Civil Effects Test Operations
U. S. Atomic Energy Commission

Edgerton, Germeshausen & Grier, Inc.
Santa Barbara Operations
Santa Barbara, California

April 1961

TECHNICAL PARTICIPANTS

H. M. Borella, Edgerton, Germeshausen & Grier, Inc., Santa Barbara, Calif.

J. T. Brashears, Edgerton, Germeshausen & Grier, Inc., Las Vegas, Nev.

L. E. Burpee, Edgerton, Germeshausen & Grier, Inc., Santa Barbara, Calif.

Z. G. Burson, Edgerton, Germeshausen & Grier, Inc., Las Vegas, Nev.

William Lee, Edgerton, Germeshausen & Grier, Inc., Santa Barbara, Calif.

E. J. Martchenke, Edgerton, Germeshausen & Grier, Inc., Santa Barbara, Calif.

ABSTRACT

A study was undertaken to determine the protection against fallout radiation provided by an earth-covered shelter. The study indicated that the shelter offered excellent protection from fallout radiation deposited on and around the shelter. This study also added additional data to the research in radiation shielding provided by various structures which is being conducted by the Civil Effects Test Operations, Division of Biology and Medicine, U. S. Atomic Energy Commission.

A fallout radiation field was simulated by pumping, at constant speed, a sealed Co⁶⁰ source through a long length of tubing which was evenly distributed over an area. Radiation measurements were made inside the shelter by dose-integrating ionization chambers.

In general, the results indicated that the protection factor (ratio of the open-field exposure dose rate to the exposure dose rate in the structure) was approximately 5000 in the center of the shelter, increasing to 10,000 to 15,000 along the sides, and decreasing to about 3000 near the ends. Directly below vents the protection factor was found to be approximately 2500 at the 3-ft level.

The shelter was a half-round corrugated-steel structure covered by a minimum of approximately 2 ft of earth on the top and 5 to 7 ft of earth on the sides.

PREFACE

The Atomic Energy Commission was requested by the Director of the Office of Civil and Defense Mobilization, the agency responsible for national civil defense, to assist in determining the radiation protection provided by an earth-covered shelter. This report contains the results of experimental measurements that were conducted during September and October 1960. The data contained in this report add to a growing body of experimental information on the radiation protection factors of a variety of structures. The measurements were made by Edgerton, Germeshausen & Grier, Inc., for the Civil Effects Test Operations, Division of Biology and Medicine, USAEC.

ACKNOWLEDGMENTS

The authors wish to express their appreciation to the participants, whose untiring efforts made possible the successful completion of the experiment. Also, the authors gratefully acknowledge the many valuable contributions made by each of the following:

R. L. Corsbie, L. J. Deal, and members of the Civil Effects Test Operations staff for over-all support.

J. E. Miller and other members of the Office of Civil and Defense Mobilization, Region 3, staff.

CONTENTS

ABSTRACT	5
PREFACE	6
ACKNOWLEDGMENTS	7
CHAPTER 1 INTRODUCTION	11
1.1 Background	11
1.2 Objectives	11
1.3 Description of the Shelter	11
CHAPTER 2 EXPERIMENTAL METHOD	13
2.1 General Description	13
2.2 Moving-point-source System	13
2.3 Sources	14
2.4 Instrumentation	14
2.5 Experimental Technique	15
CHAPTER 3 PRESENTATION OF DATA	28
3.1 Dose Measurements	28
3.2 Energy Measurements	28
3.3 Point-source Measurements	28
CHAPTER 4 ANALYSIS AND CONCLUSIONS	36
4.1 General	36
4.2 Protection Factors	37
4.3 Energy Measurements	37
4.4 Discussion and General Conclusions	38
APPENDIX A RADIOLOGICAL-SAFETY OPERATIONS	41
APPENDIX B SAMPLE OF DATA, ANALYSIS, AND EVALUATION	43

ILLUSTRATIONS

CHAPTER 1 INTRODUCTION

1.1 Longitudinal Sectional View of Shelter	12
1.2 South End (Main Entrance) Elevation of Shelter	12

ILLUSTRATIONS (Continued)

CHAPTER 2 EXPERIMENTAL METHOD

2.1 Caisson Trailer	16
2.2 Laboratory Truck	16
2.3 The 200-curie Co ⁶⁰ Source Shield	17
2.4 Interior of Source Truck Showing Shields and Pumping System	17
2.5 Emergency Hand Pump	18
2.6 Remote-control Console	18
2.7 Source-position Indicator	19
2.8 The 200-curie Co ⁶⁰ Source Capsule	19
2.9 Ionization Chambers and Charger-Readers	20
2.10 Calibration Curve for Victoreen Model 239 Ionization Chambers	21
2.11 Energy Response of Victoreen Model 239 Ionization Chamber	22
2.12 The 256-channel Analyzer and Associated Equipment	23
2.13 Tubing Layout at Shelter	24
2.14 Tubing Layout at Shelter	25
2.15 Tubing Layout at Shelter	25
2.16 Dosimeter Positions Inside Shelter	26
2.17 Air Vent on Top of Shelter	26
2.18 Floor Plan of Shelter Showing Crystal Assembly (A, B, C) and Dosimeter (X) Positions	27

CHAPTER 3 PRESENTATION OF DATA

3.1 Pulse-height Distribution from Co ⁶⁰ Standard	30
3.2 Pulse-height Distribution 3 Ft Above Rectangular Area Source	31
3.3 Pulse-height Distribution at Position A from 196-curie Co ⁶⁰ Source	32
3.4 Pulse-height Distribution at Position B from 196-curie Co ⁶⁰ Source	33
3.5 Pulse-height Distribution at Position B from 16.3-curie Co ⁶⁰ Source	34
3.6 Pulse-height Distribution at Position C from 16.3-curie Co ⁶⁰ Source	35

CHAPTER 4 ANALYSIS AND CONCLUSIONS

4.1 Protection Factors Plotted on Floor Plan at Different Heights Above Floor	40
--	----

TABLES

CHAPTER 3 PRESENTATION OF DATA

3.1 Dose Rates Inside the Shelter	29
3.2 Data from Point Source Placed on Vent	29

CHAPTER 4 ANALYSIS AND CONCLUSIONS

4.1 Protection Factors at Positions in the Shelter	39
--	----

APPENDIX B SAMPLE OF DATA, ANALYSIS, AND EVALUATION

B.1 Correction and Normalization of Data	43
--	----

Chapter 1

INTRODUCTION

1.1 BACKGROUND

Although theoretical estimates can provide, on a statistical basis, an estimate of the protection afforded by various types of structures against radiation from fallout, they do not provide specific information concerning the protection of a particular building. Recognizing the need for protection against the hazards of nuclear attacks or nuclear accidents, the Civil Effects Test Operations, Division of Biology and Medicine, of the Atomic Energy Commission has conducted a series of measurements to evaluate the protection characteristics of various structures.¹⁻⁴ The measurements made during this experiment were part of the continuing effort to meet this need.

1.2 OBJECTIVES

The objectives of the experiment were as follows:

1. To determine the radiation protection throughout a half-round corrugated-steel earth-covered shelter
2. To determine the pulse-height distribution of the radiation inside the shelter from a plane radiation source on and around the shelter

1.3 DESCRIPTION OF THE SHELTER

The shelter, 20 ft wide, 100 ft long, and 10 ft high, was part of a line of preengineered and packaged fallout shelters fabricated from 2-ft-wide sheets of galvanized steel which were vinyl coated on the interior side. The steel sheets were corrugated and curved to form self-supporting arches secured by simple nut-and-bolt fasteners. The entire shelter was covered to a minimum thickness of approximately 2 ft of earth (Figs. 1.1 and 1.2).

REFERENCES

1. J. A. Auxier et al., *Experimental Evaluation of the Radiation Protection Afforded by Residential Structures Against Distributed Sources*, USAEC Report CEX-58.1, January 1959.
2. J. F. Batter, Jr., et al., *An Experimental Evaluation of the Radiation Protection Afforded by a Large Modern Concrete Office Building*, USAEC Report CEX-59.1, January 1960.
3. J. A. Auxier and T. D. Strickler, *Experimental Evaluation of the Radiation Protection Afforded by Typical Oak Ridge Homes Against Distributed Sources*, USAEC Report CEX-59.13, April 1960.
4. H. M. Borella et al., *Evaluation of the Fallout Protection Afforded by Brookhaven National Laboratory Medical Research Center*, USAEC Report CEX-60.1, February 1961.

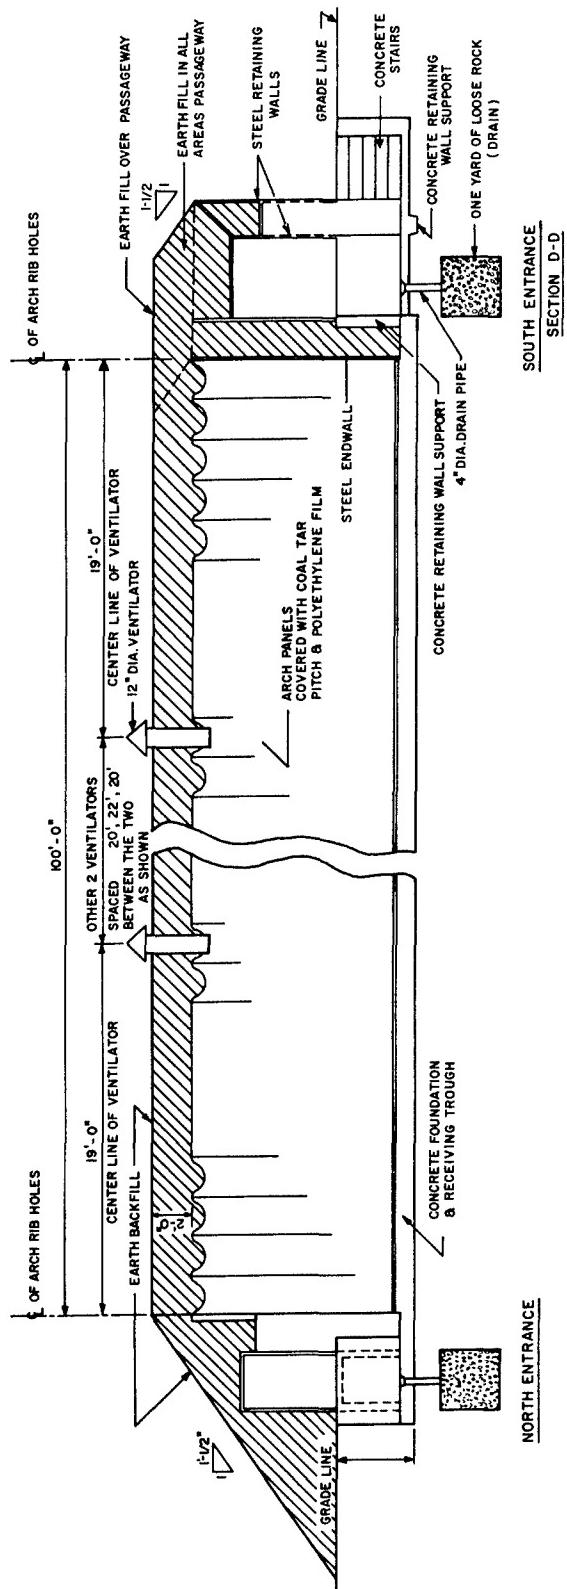


Fig. 1.1—Longitudinal sectional view of shelter.

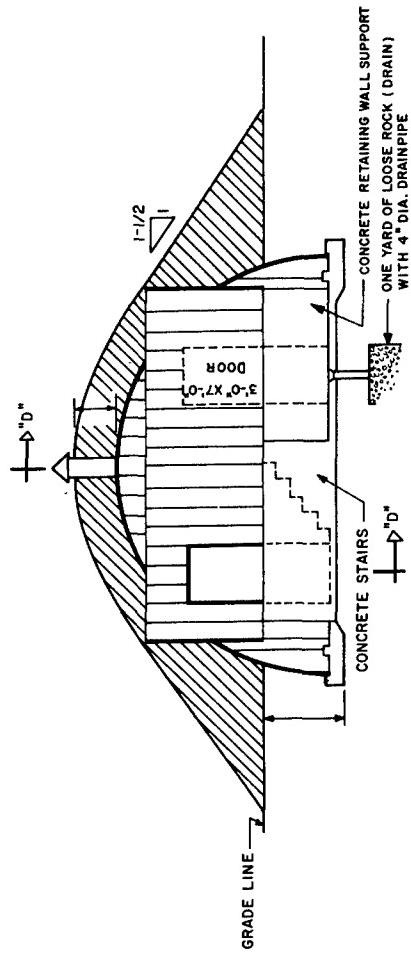


Fig. 1.2—South end (main entrance) elevation of shelter.

Chapter 2

EXPERIMENTAL METHOD

2.1 GENERAL DESCRIPTION

Two distinct types of measurements had to be made to obtain the data required to evaluate the shelter. First, the exposure dose rate was measured inside the shelter from a radioactive source evenly distributed on the ground above and surrounding the shelter. Second, the pulse-height distribution of the radiation as it entered the shelter was measured using the same source geometry.

For the first measurement a 196-curie Co⁶⁰ source was pumped at a uniform rate through a length of tubing. This tubing was prepositioned over and around the shelter so that the amount of tubing per unit area was constant. The source was pumped at a uniform rate, thus simulating an area of uniformly distributed radioactivity. Radiation doses were measured inside the structure at the desired locations by highly sensitive ionization chambers.

For the pulse-height distribution measurements, a 16.3-curie Co⁶⁰ source was pumped through the tubing, which was laid out in the same configuration as for the dose measurements. A 256-channel analyzer was used to obtain the energy measurements.

2.2 MOVING-POINT-SOURCE SYSTEM

For this project, a method of source circulation similar to the one used during the CEX-58.6, CEX-59.13, and CEX-60.1 experiments was used. This system consisted of a hydraulic pumping unit, associating tubing, source-position indicators, a remote-control console, source shield (pigs), 200- and 20-curie Co⁶⁰ source containers (slugs), and interconnecting cables. The Co⁶⁰ slug was pumped from the pig, through the tubing, and back into the pig.

Three vehicles contained the apparatus. The hydraulic system and source shields were mounted on one truck. Tubing reels, power- and signal-cable reels, and a 5-kw emergency generator were on a caisson trailer (Fig. 2.1). A laboratory truck contained the control console, tools, supplies, and general equipment for the system (Fig. 2.2).

A means of storing the slug when it was not being pumped through the tubing was provided by the 200-curie Co⁶⁰ source shield. Two S-shaped stainless-steel tubes in which the slug traveled were within the shield. Stops were provided in the center of each tube to halt the motion of the slug when it returned to the shield. A method was devised for locking the slug in place when it was not being used. A picture of this shield is presented in Fig. 2.3.

A modified shipping container comprised the 20-curie Co⁶⁰ source shield. The two source shields, an air compressor (used to empty the water from the tubing), and the hydraulic system were mounted in a truck (Fig. 2.4).

The hydraulic pumping system consisted of a 120-gal reservoir, a 1-hp 220-volt electric motor, a piston type positive-displacement pump, filters, several hand-operated and electrically operated solenoid valves, and connecting lines. The outside diameter of the source cap-

sule was slightly less than the inside diameter of the tubing. A flow system rather than a pressure-differential system was employed. The internal pressure in normal operation was about 100 psi when 3000 ft of tubing was used, and the source traveled at 120 ft/min.

An emergency hand pump capable of retrieving the slug from either direction was provided as an auxiliary unit in the event of failure of the main unit. This hand device was situated 100 ft away from the source shield (Fig. 2.5).

Operation of the system was remotely controlled from the console (Fig. 2.6) in the laboratory truck, about 500 ft from the pumping system. It was possible to start, stop, or reverse the movement of the slug with maximum speed obtainable in either direction from this console. Twenty movable magnetic indicators (Fig. 2.7) were used to locate the slug as it moved through the tubing. These indicators were clamped to desired points on the tubing and were connected individually to a series of lights on the console panel.

The Co⁶⁰ source was encapsulated in a magnetic stainless-steel container. It was conveyed by water through $\frac{1}{2}$ -in. Marlex (high-density polyethylene) tubing, rated at 200-psi hoop-stress at 130° for a one-year period. Burst pressure was rated in excess of 1000 psi. The tubing bend radius was limited to a minimum of 2 ft.

2.3 SOURCES

Radioactive sources used during this experiment were:

1. One 196-curie Co⁶⁰ source
2. One 16.3-curie Co⁶⁰ source
3. One 2.86-mc Co⁶⁰ source

The 196-curie Co⁶⁰ source was doubly encapsulated in magnetic stainless-steel containers. Two containers (each holding approximately 100 curies) were connected by a flexible-steel cable $\frac{3}{4}$ in. long (Fig. 2.8). The outside diameter of the container was slightly less than the inside diameter of the tubing, thus allowing the source to pass through the tubing (even when curved) with ease and safety. The source had been calibrated during a previous exercise and indicated at the time of this experiment a strength of 196 curies.

The 16.3-curie Co⁶⁰ source was also encapsulated in a magnetic stainless-steel container. This source also had been calibrated during a previous exercise; at the time of this experiment a strength of 16.3-curies was indicated.

The 2.86-mc Co⁶⁰ source was normally used for demonstration purposes. It was calibrated by ionization chambers.

2.4 INSTRUMENTATION

The instrumentation used in this experiment included pocket ionization chambers, associated charger readers, and a 256-channel analyzer.

Pocket ionization chambers were:

1. 10 Bendix model 611 0- to 5-r chambers
2. 75 Victoreen model 362 0- to 200-mr chambers
3. 145 Victoreen model 239 0- to 10-mr chambers

Victoreen model 287 minometers were used for charging and reading the model 362 and 239 ionization chambers (see Fig. 2.9).

Ionization chambers were calibrated prior to the experiment with a Co⁶⁰ standard. Figure 2.10 is a sample calibration curve.

An energy-response curve was obtained from the Victoreen Instrument Company for the 0- to 10-mr chambers (Fig. 2.11).

The 256-channel analyzer and associated equipment (Fig. 2.12) were used to measure the energy of the radiation entering the shelter. The system consisted of:

1. A 2-in. by 2-in. NaI crystal optically coupled to a photomultiplier tube
2. A Nuclear Data model ND-101 transistorized 256-channel analyzer
3. A John Fluke model 402M high-voltage supply
4. An IBM typewriter for automatic numerical print-out

2.5 EXPERIMENTAL TECHNIQUE

The experimental technique consisted in measuring the radiation at points within the shelter from a simulated contaminated area of known source strength above and surrounding the shelter. This contaminated field was simulated by moving a point source at constant speed over the area of interest so that the source spent the same time interval per unit area over the entire area. By the use of dose-integrating detectors within the shelter, the total radiation dosage was made to appear as if arising from an area source. This technique has the advantage of averaging local features of the terrain and the building under test in much the same way as would a true fallout field.

Approximately 3000 ft of tubing was used, covering approximately 12,000 sq ft (Figs. 2.13 through 2.15).

The radiation-dose measurements were obtained by pumping a 196-curie Co⁶⁰ source through the tubing and measuring the accumulated doses with the low-range ionization chambers (10 mr full scale). The actual test exposure was approximately 2½ hr to ensure readings sufficiently high for valid statistical evaluation.

Experiment procedures consisted of the following:

1. The polyethylene tubing was distributed over the desired area according to a predetermined plan.
2. A dummy source capsule was then pumped through the tubing to make certain it had not been damaged during placement. At this time, the dosimeters were charged.
3. The dosimeters were placed in paper cups attached to strings hung from aluminum stands (Fig. 2.16).
4. When radiological safety clearance was given, the system was energized, and the test run was made. At the conclusion of the test exposure, the source was secured in its shield, the dosimeters were read, and the readings were recorded.

The accumulation of fallout on top of the air vents was simulated by placing a point source of 2.86 mc in the center (on top) of one of the vents (see Fig. 2.17). Dosimeters were placed 21 in. off center as well as directly below the air vent.

Measurements of the radiation energy entering the shelter were made using the same tubing configuration used for the dose measurements. These energy measurements were made employing a 16.3-curie Co⁶⁰ source as well as the 196-curie Co⁶⁰ source. Data were taken at three positions at a height of 4 ft above the floor inside the shelter. These positions (Fig. 2.18) were: (1) near the center between two vents (position A), (2) near a corner at the front entrance (position B), and (3) exact center under a vent (position C).

In addition, measurements were made 3 ft above the center of a square simulated area source 54 by 54 ft. The tubing was placed on the ground (in a level unobstructed area) with a 4½-ft spacing, and the 2.86-mc Co⁶⁰ source was pumped through it. These measurements were taken to ascertain the energy spectrum 3 ft above a plane source of radiation. Backgrounds were taken for all measurements.

Unauthorized entrance into the test area was restricted during the test runs. A radiological safety plan was formulated, and this plan served as a basis for conducting the experiment (Appendix A).

The test was performed at night to minimize inconvenience to workers in nearby buildings. Telephone contact was maintained at all times with the local representatives during the test exposures.

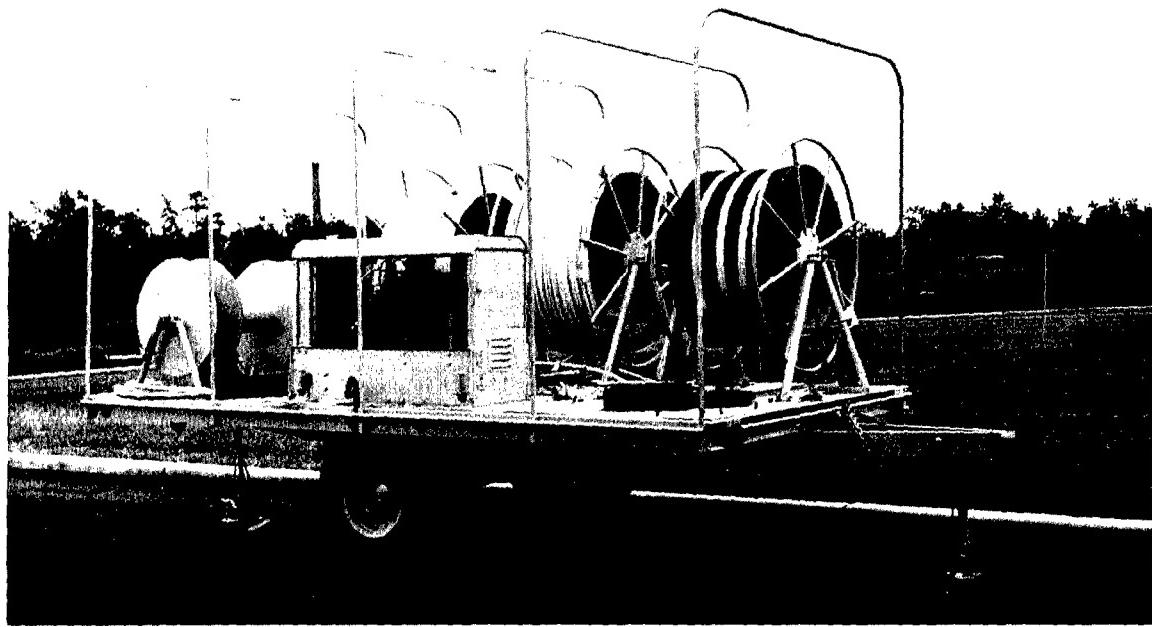


Fig. 2.1—Caisson trailer.



Fig. 2.2—Laboratory truck.

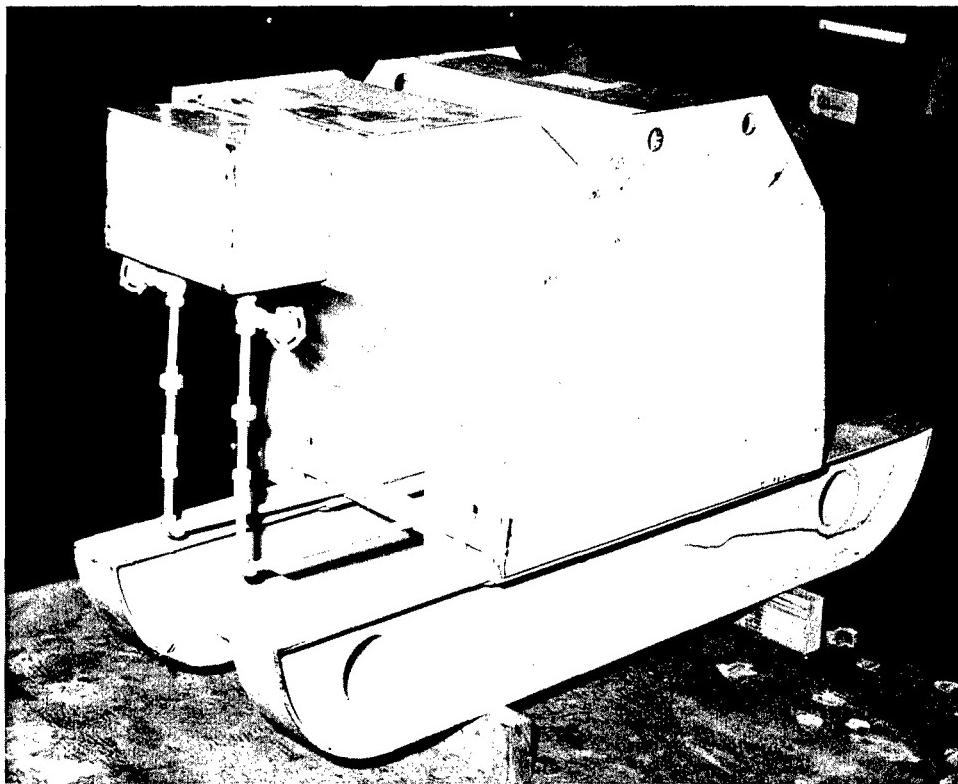


Fig. 2.3—The 200-curie Co⁶⁰ source shield.

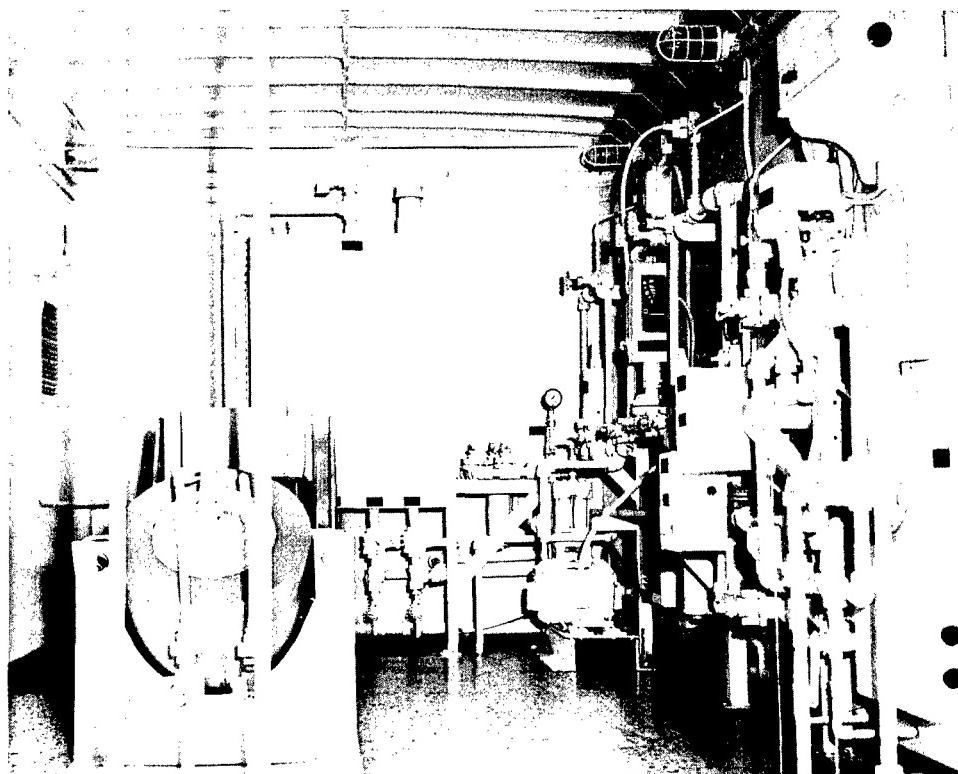


Fig. 2.4—Interior of source truck showing shields and pumping system.

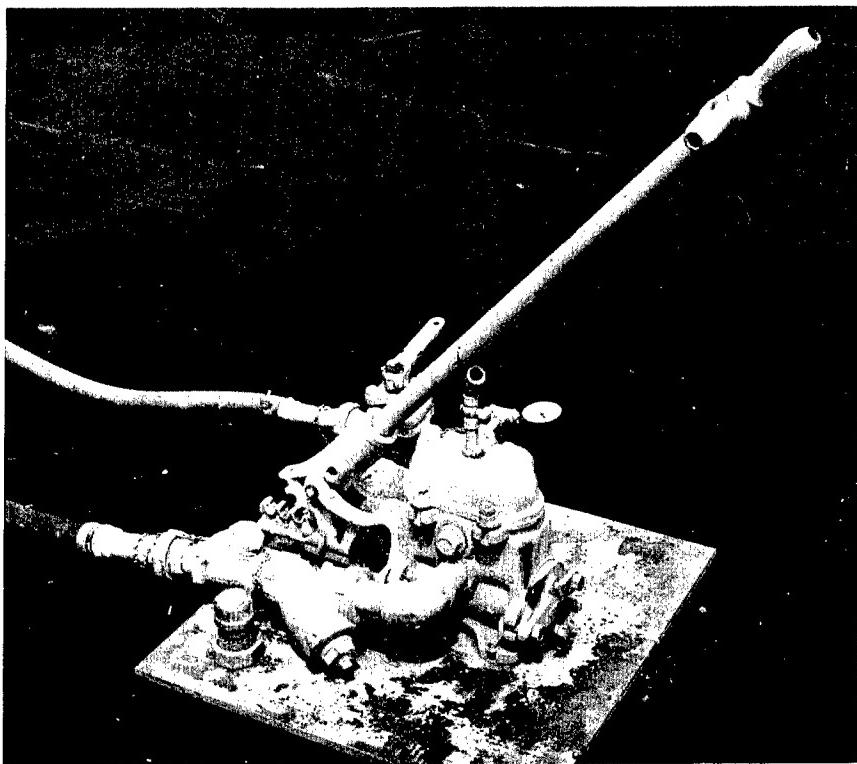


Fig. 2.5—Emergency hand pump.

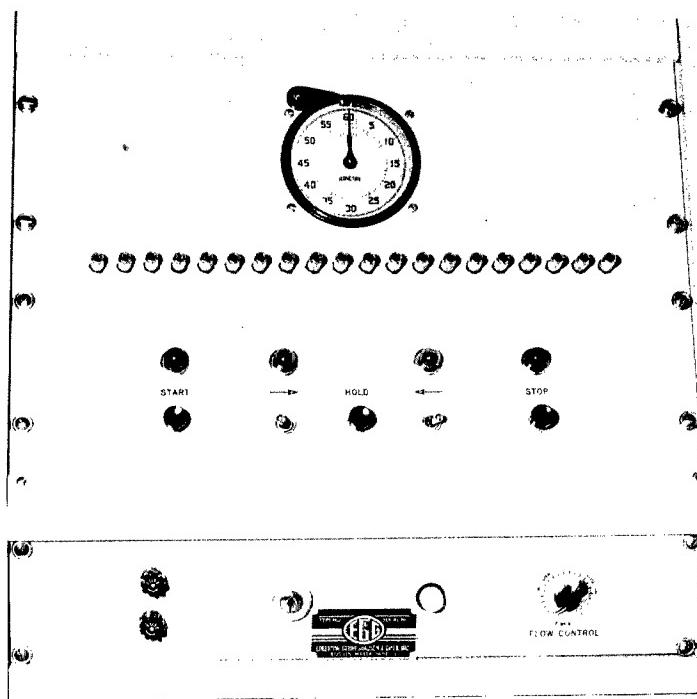


Fig. 2.6—Remote-control console.

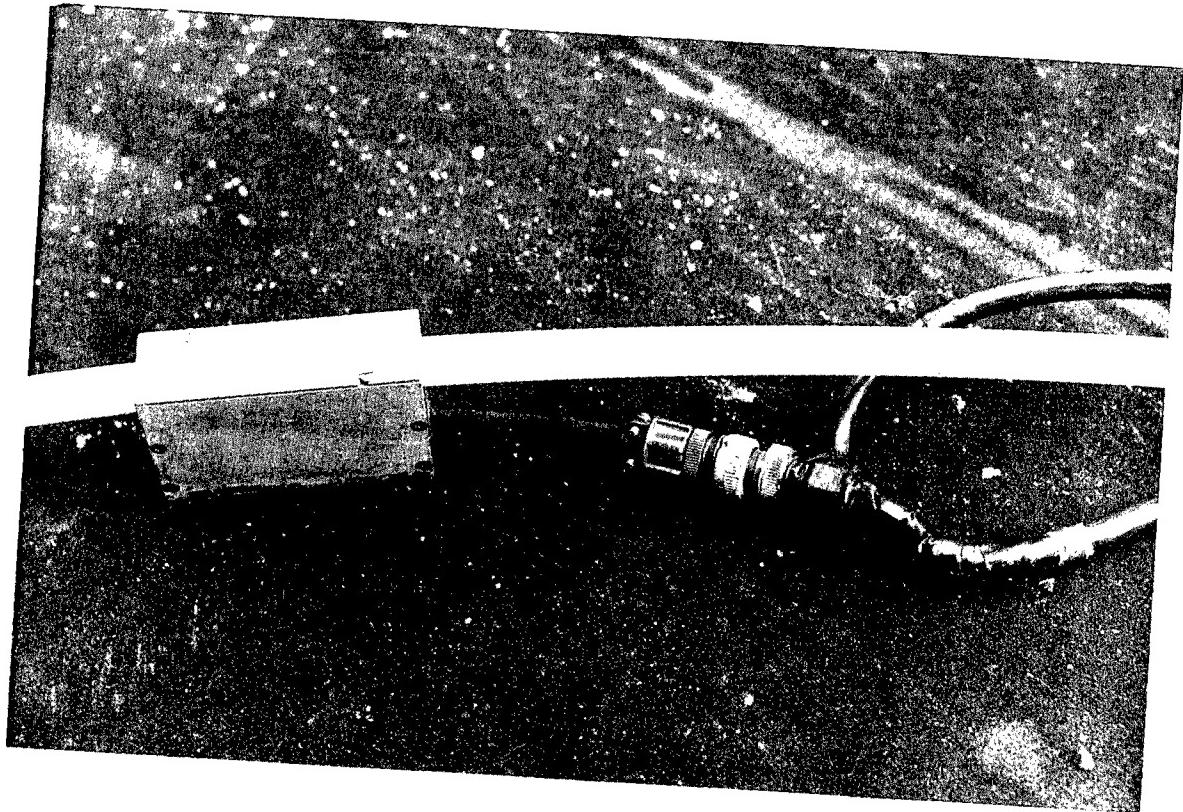


Fig. 2.7—Source-position indicator.

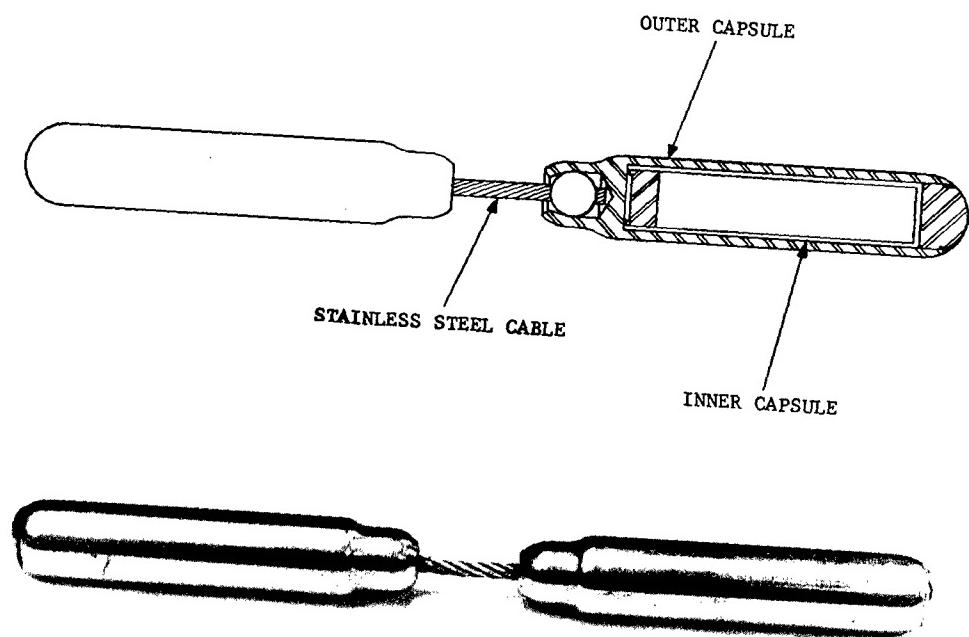


Fig. 2.8—The 200-curie Co^{60} source capsule.

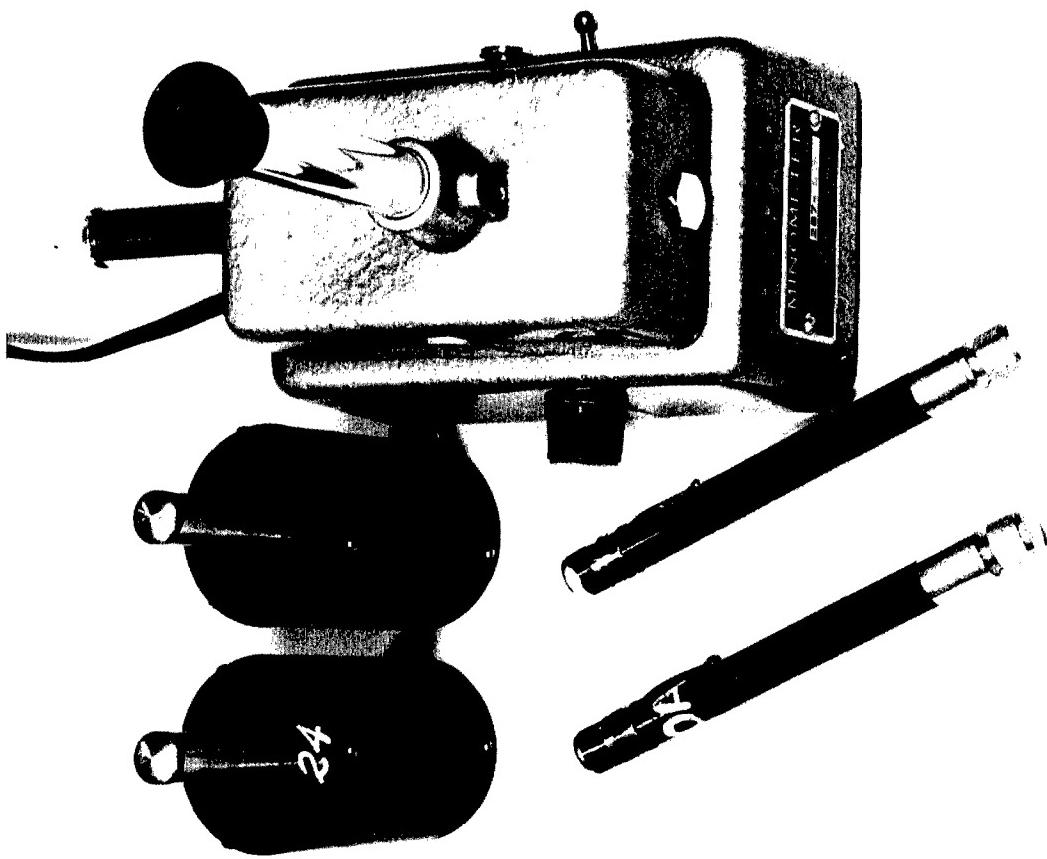


Fig. 2.9—Ionization chambers and charger-readers.



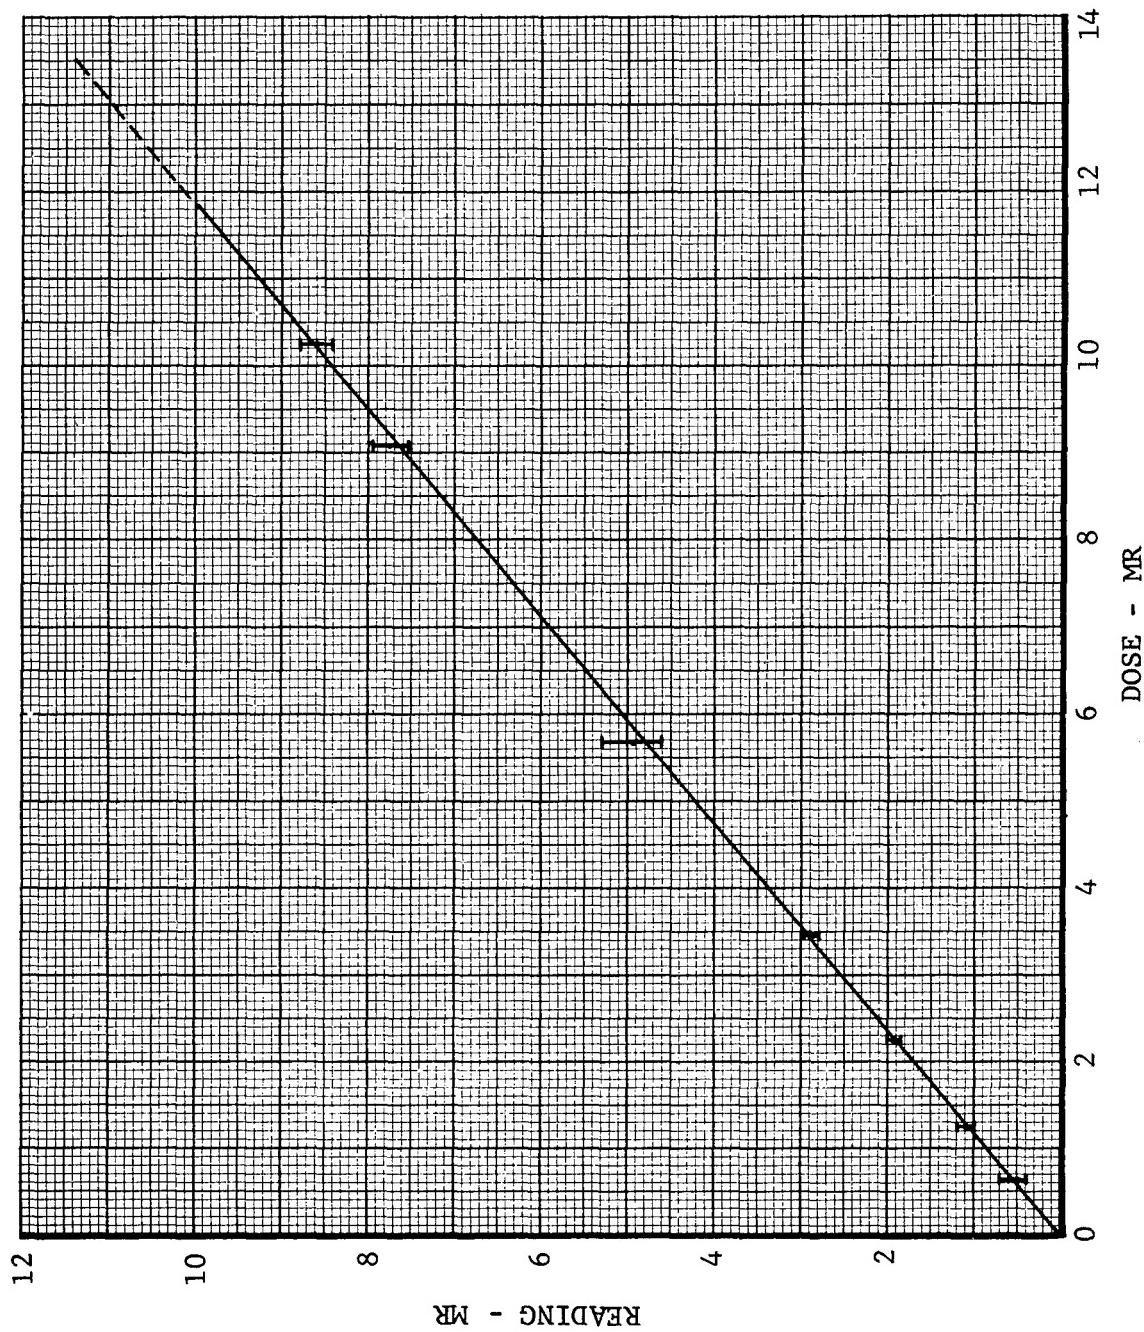


Fig. 2.10—Calibration curve for Victoreen model 239 ionization chambers.

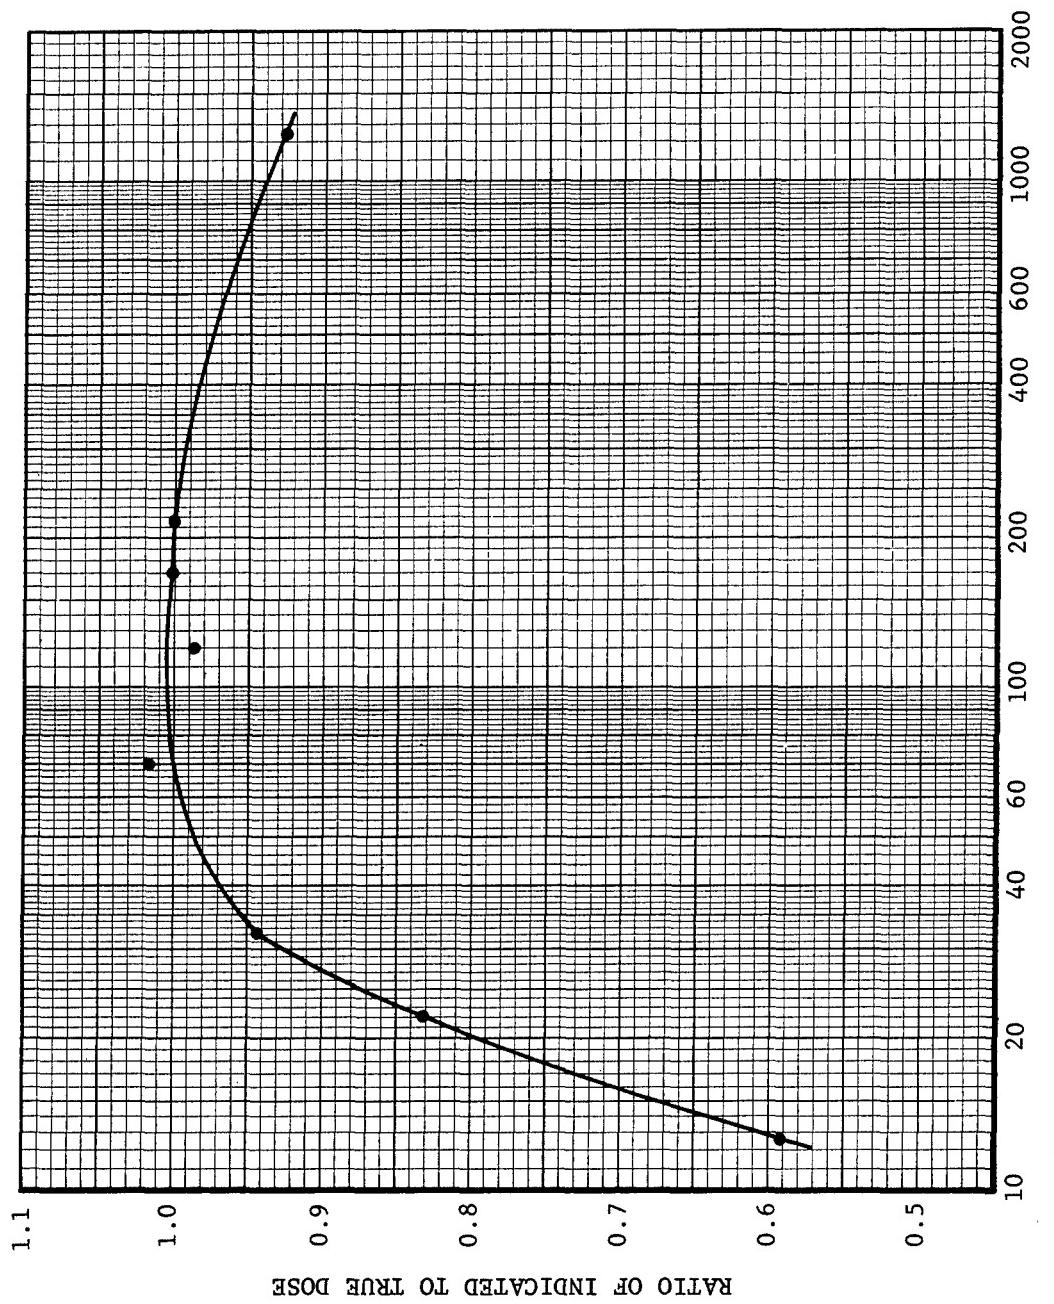


Fig. 2.11—Energy response of Victoreen model 239 ionization chamber.

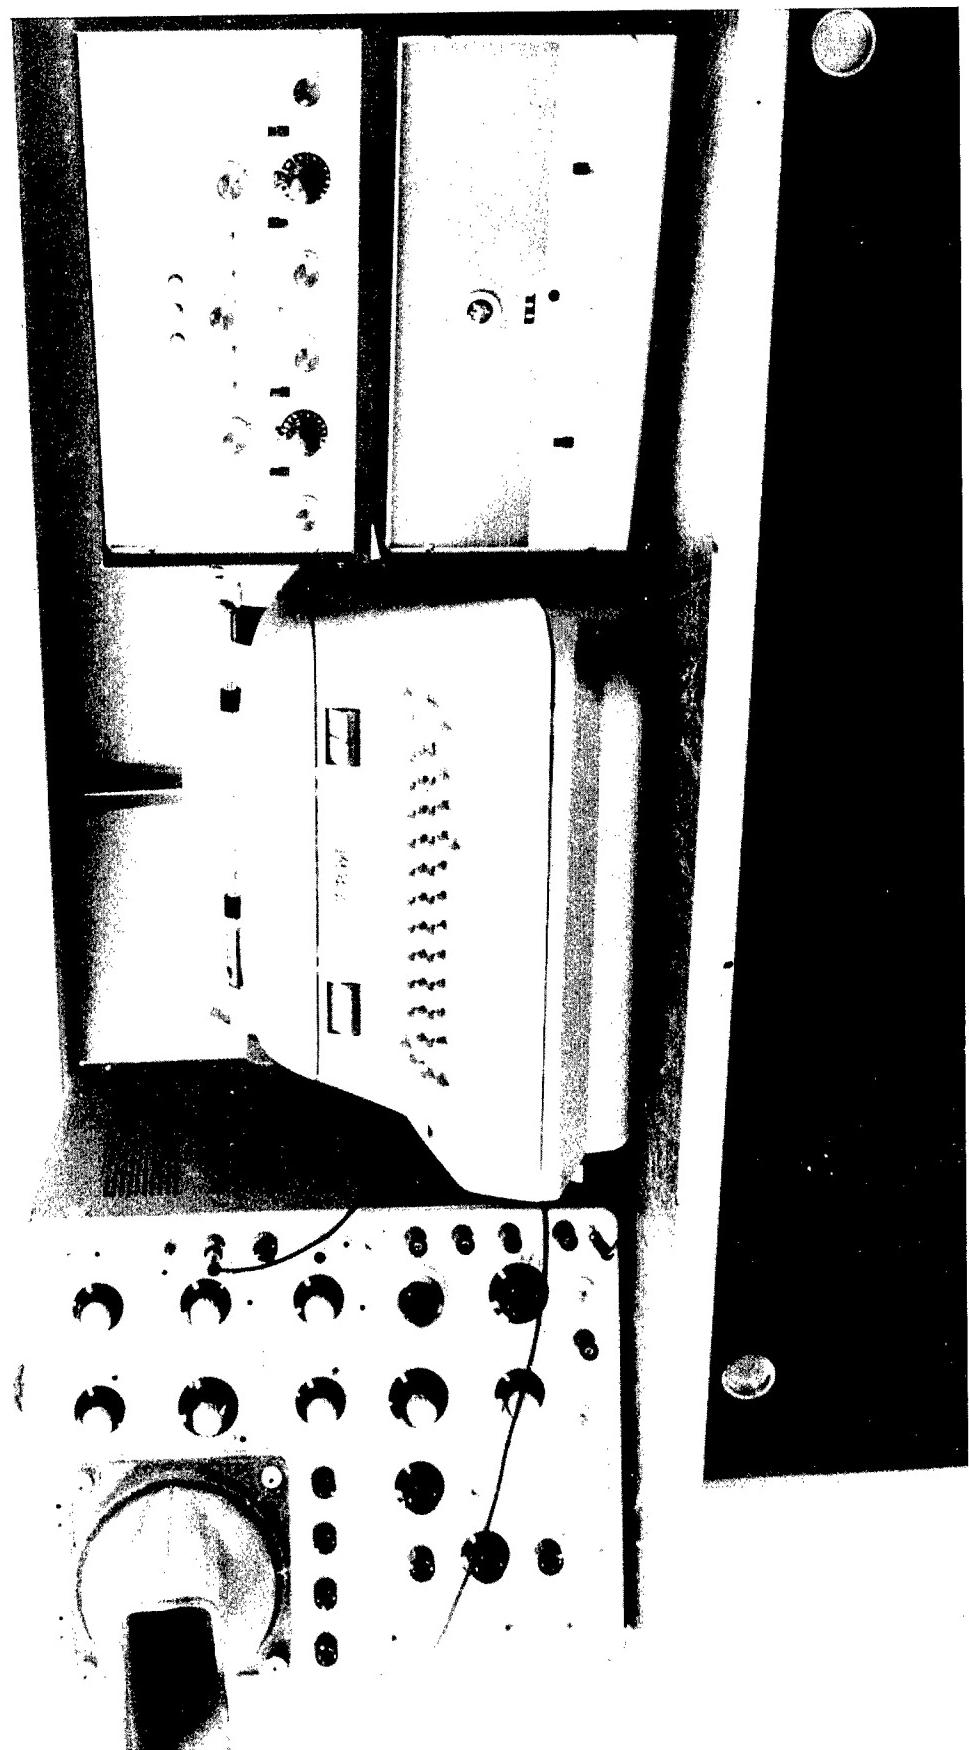


Fig. 2.12—The 256-channel analyzer and associated equipment.



Fig. 2.13—Tubing layout at shelter.



Fig. 2.14—Tubing layout at shelter.



Fig. 2.15—Tubing layout at shelter.

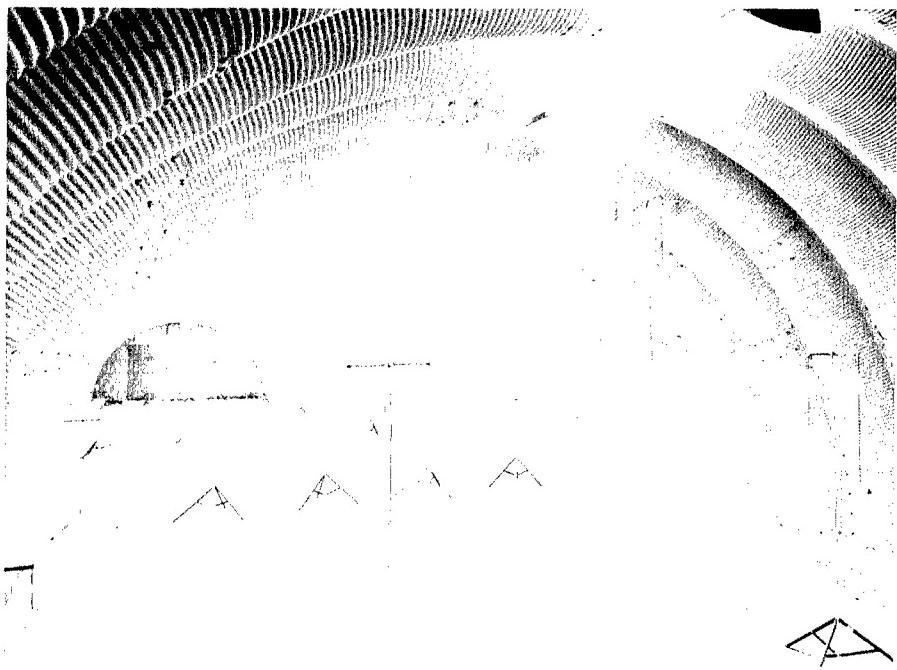


Fig. 2.16—Dosimeter positions inside shelter.

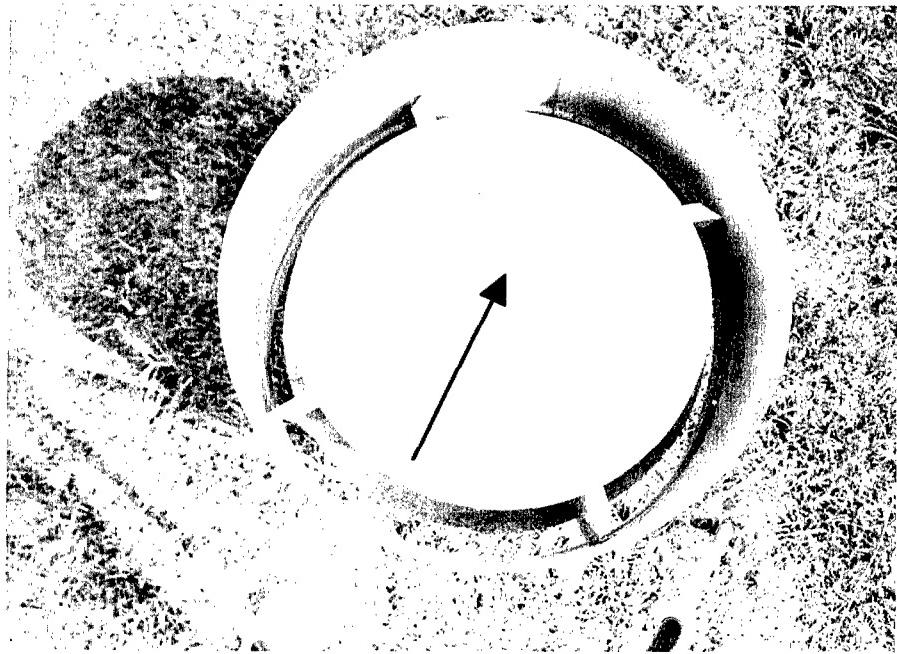


Fig. 2.17—Air vent on top of shelter. Arrow shows position of point source.

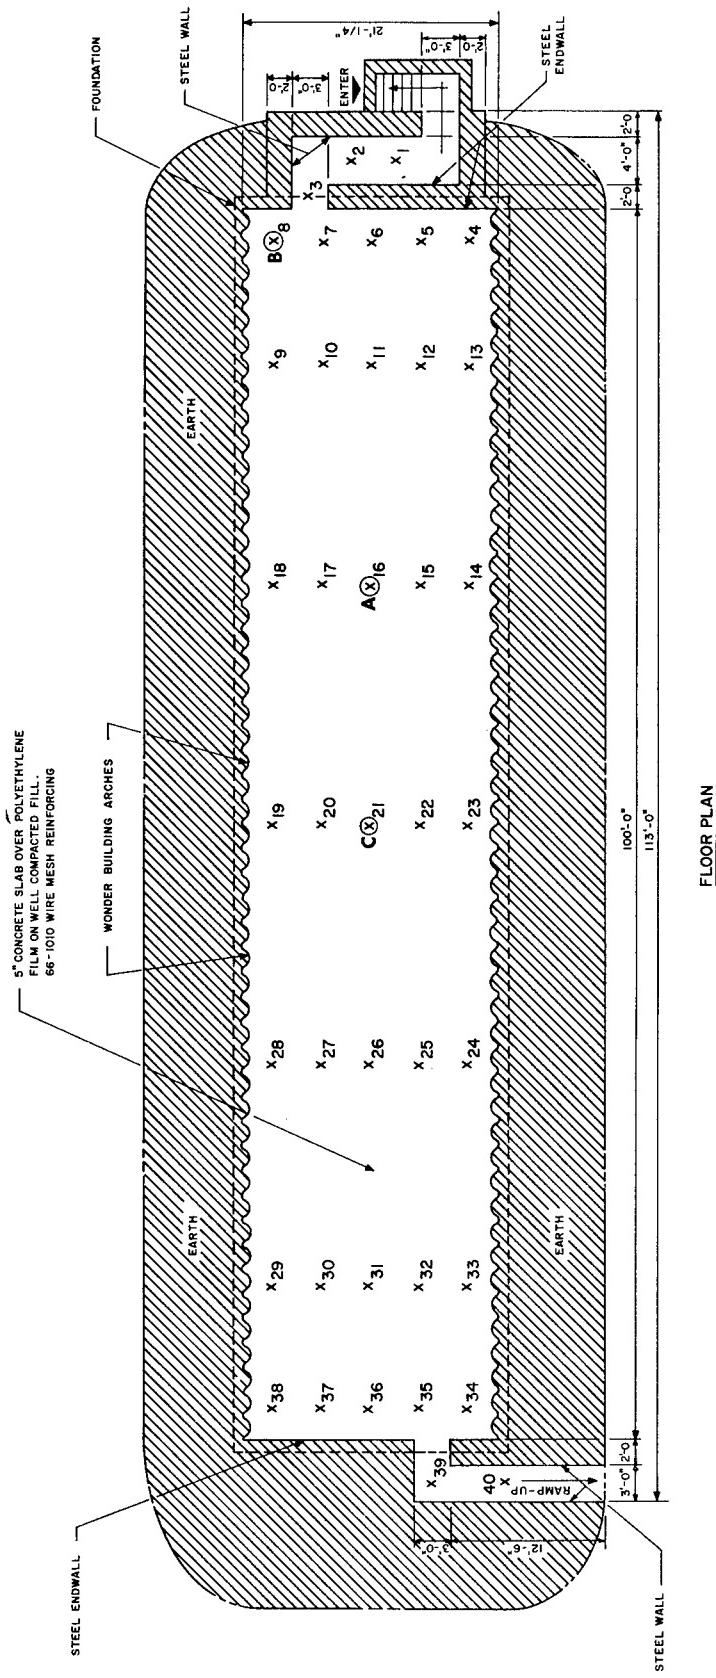


Fig. 2.18—Floor plan of shelter showing crystal assembly (A,B,C) and dosimeter (X) positions.

FLOOR PLAN

Chapter 3

PRESENTATION OF DATA

3.1 DOSE MEASUREMENTS

An area source of radioactivity was simulated over and around the shelter, and dose measurements were made within. The 196-curie Co^{60} source was pumped through the tubing, which was evenly distributed over an area of 11,160 sq ft. The exposure time was 2.456 hr.

At least two dosimeters were placed at each position. Their readings were averaged and corrected for leakage, temperature, pressure, and calibration and then normalized to milliroentgens per hour per millicurie per square foot. Figure 2.18 shows a floor plan of the shelter with dosimeter position numbers. The normalized data are presented in Table 3.1 at different heights above the floor and at various positions throughout the shelter.

3.2 ENERGY MEASUREMENTS

Presented in Fig. 3.1 is a pulse-height distribution taken by placing a Co^{60} standard directly on the face of the 2- by 2-in. crystal. The energy peaks at 1.17 and 1.33 Mev are quite evident. Measurements of the pulse-height distribution were taken 3 ft above a rectangular simulated area source using Co^{60} . These measurements appear in Fig. 3.2. The pulse-height distribution of the radiation entering the shelter appears in Figs. 3.3 through 3.6. Two measurements were taken using the 196-curie source, and two were taken using the 16.3-curie source. (Detector-assembly positions appear in Fig. 2.18.)

3.3 POINT-SOURCE MEASUREMENTS

A Co^{60} point source of 2.86 mc was placed on the top of one of the vents, and dose measurements were taken directly below. The area of the top of the vent was 1.766 sq ft, and the exposure time was 3.00 hr. The normalized data appear in Table 3.2.

Table 3.1—DOSE RATES INSIDE THE SHELTER

Position	Dose rate*				Position	Dose rate*			
	At 1 ft	At 3 ft	At 5 ft	At 7 ft		At 1 ft	At 3 ft	At 5 ft	At 7 ft
1		2.1			21		0.10	0.11	0.12
2		0.60			22		0.70	0.072	
3		0.35			23	0.037	0.033		
4	0.091	0.15			24		0.037		
5		0.21	0.32		25		0.072	0.081	
6		0.19	0.27	0.28	26		0.095	0.10	0.10
7		0.20	0.29		27		0.081	0.084	
8	0.070	0.085			28		0.030		
9		0.058			29		0.033		
10		0.12	0.17		30		0.098	0.10	
11		0.14	0.16	0.15	31		0.12	0.12	0.11
12		0.11	0.11		32		0.079	0.070	
13		0.056			33		0.042		
14		0.044			34	0.044	0.042		
15		0.091	0.091		35		0.093	0.097	
16		0.11	0.12	0.12	36		0.18	0.23	0.26
17		0.086	0.087		37		0.21	0.31	
18		0.040			38	0.058	0.084		
19	0.037	0.037			39		1.21		
20		0.081	0.081		40		17.4		

Position	Placement	Dose rate*
41	3 in. below roof under maximum thickness of earth	0.081
42	3 in. below roof under minimum thickness of earth	0.14
43	3 in. directly below vent	2.4
44	2 ft directly below vent	0.56
45	Corner, 2 in. from wall	0.023
46	Edge, 6 in. from wall	0.12
47	Center on floor	0.086

* Normalized to milliroentgens per hour per millicurie per square foot.

Table 3.2—DATA FROM POINT SOURCE PLACED ON VENT

Position	Dose rate*		
	At 3 ft	At 5 ft	At 7 ft
Directly below center of vent	0.11	0.15	0.34
21 in. from center of vent	0.021	0.021	0.021

* Normalized to milliroentgens per hour per millicurie per square foot.

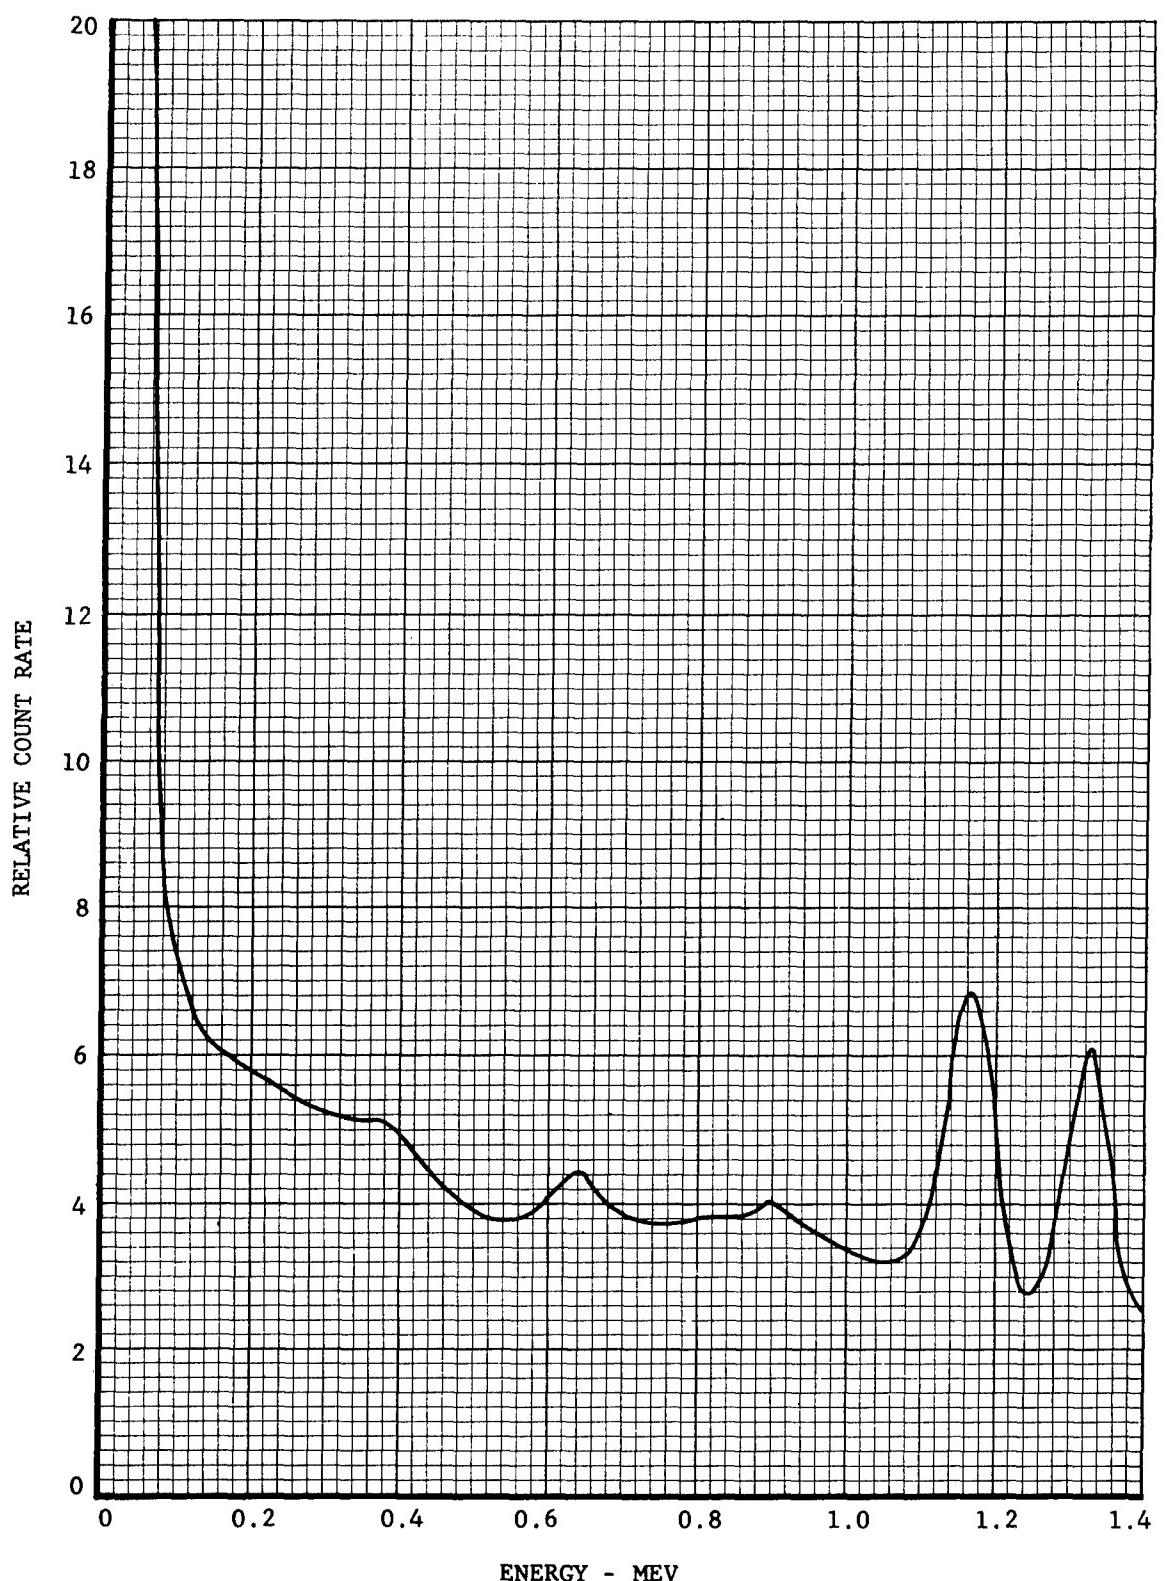


Fig. 3.1—Pulse-height distribution from Co^{60} standard.

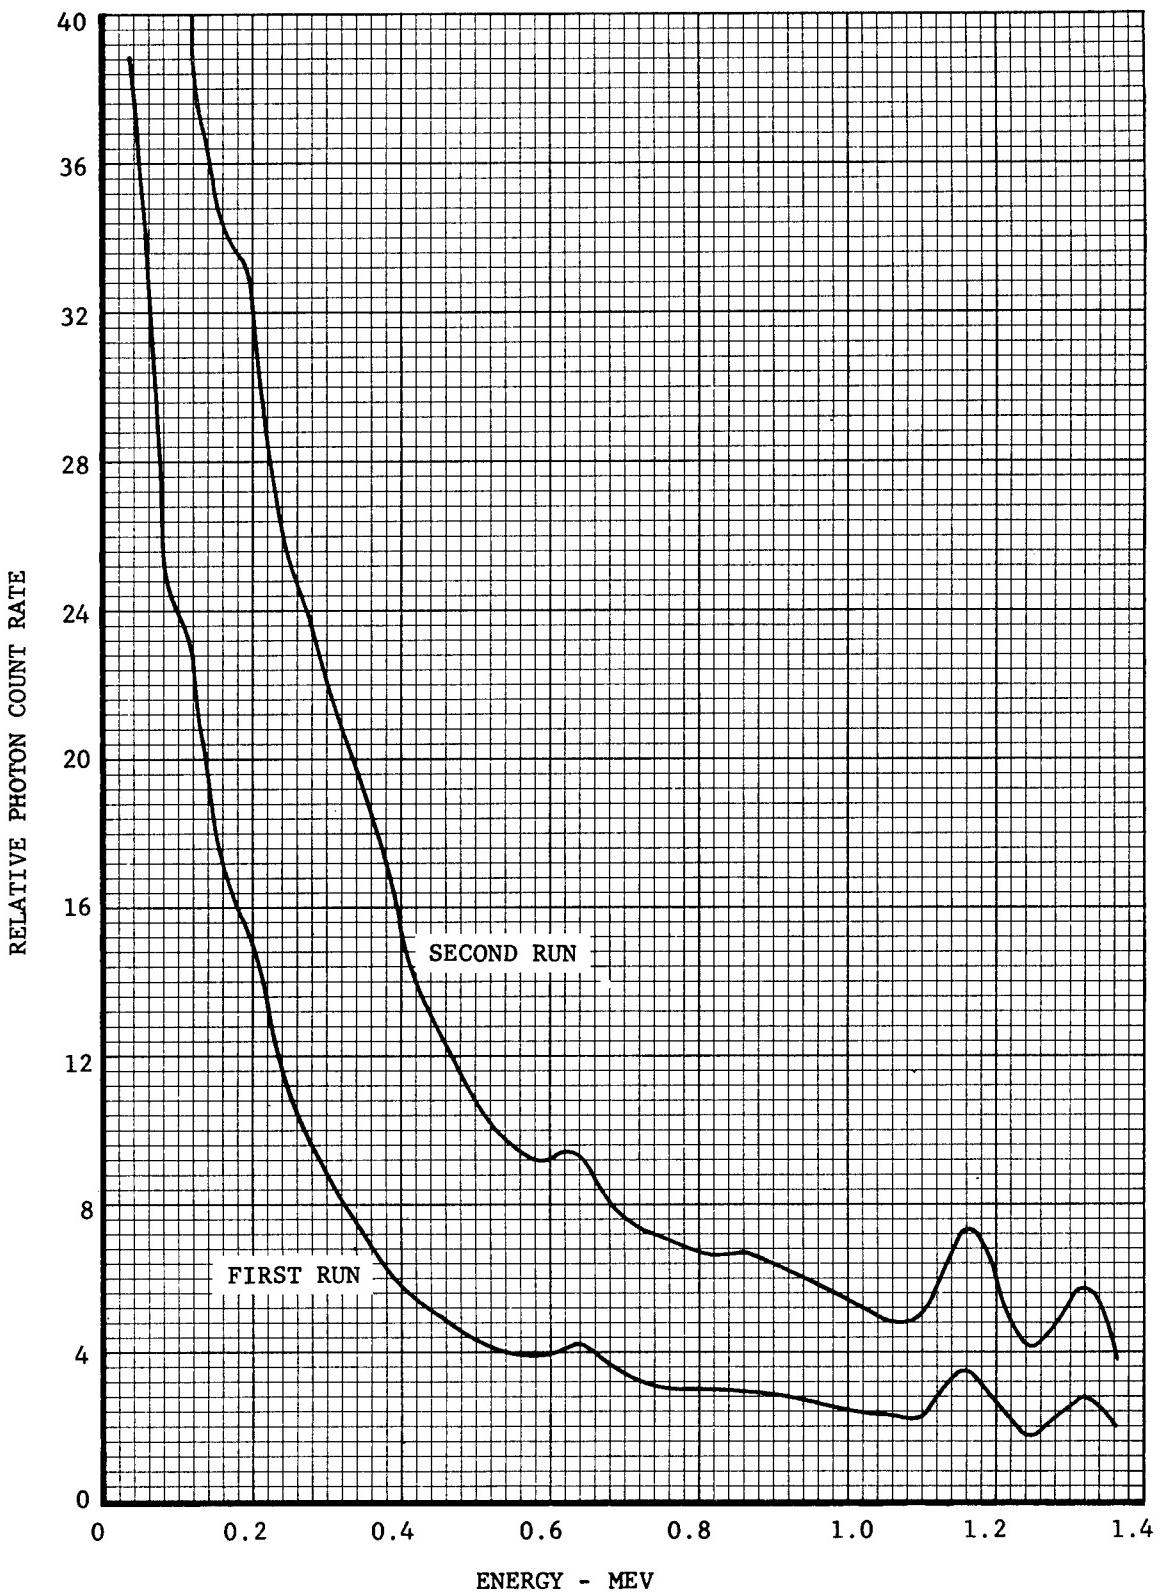


Fig. 3.2—Pulse-height distribution 3 ft above rectangular area source.

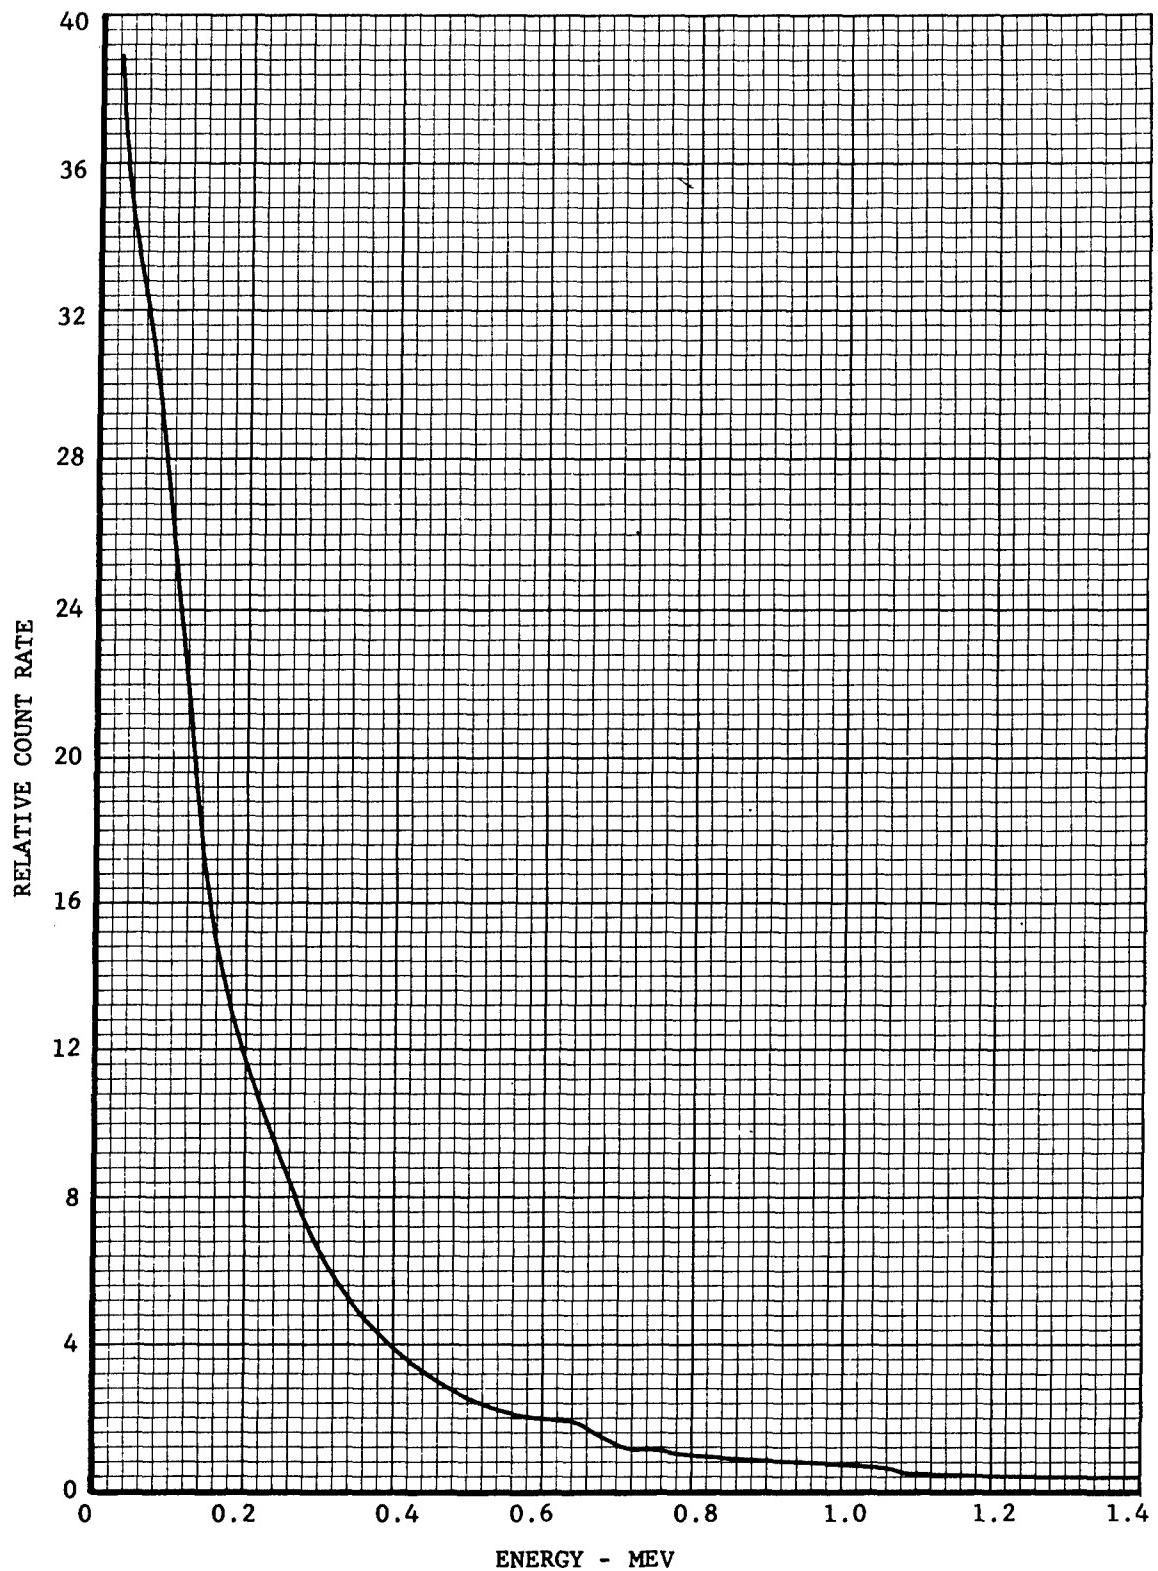


Fig. 3.3—Pulse-height distribution at position A from 196-curie Co^{60} source.

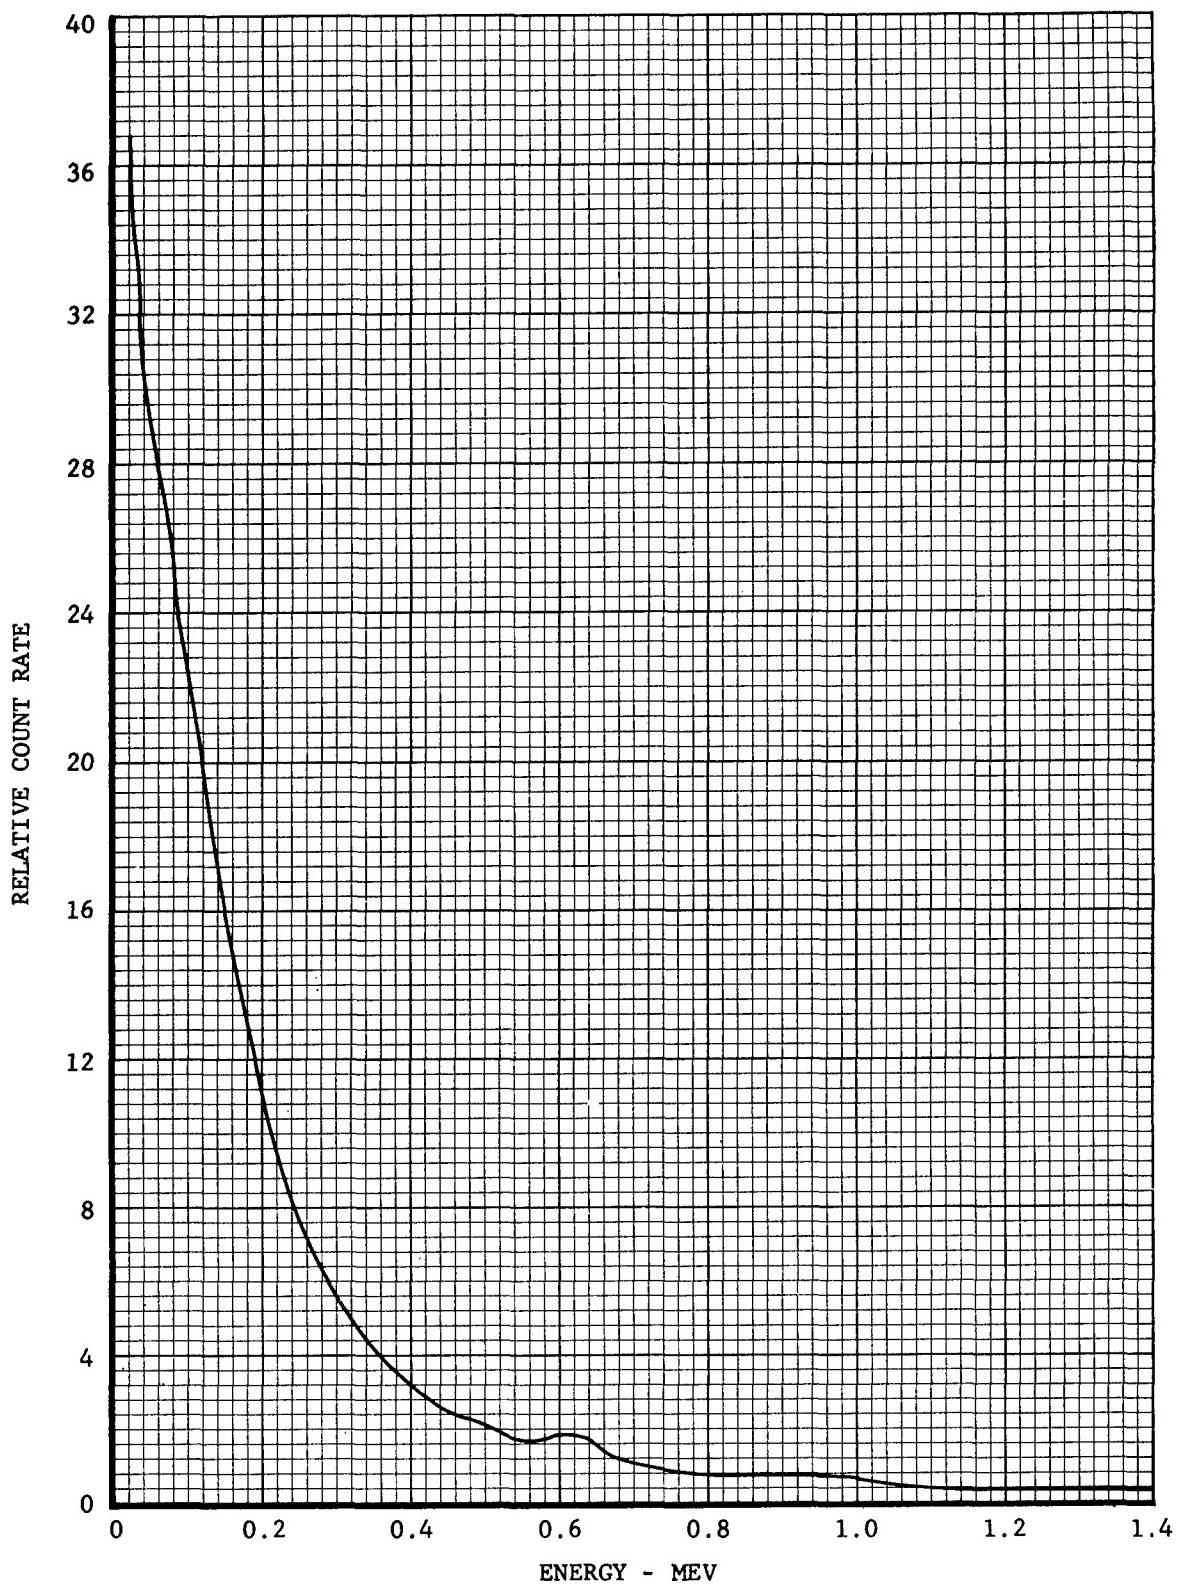


Fig. 3.4—Pulse-height distribution at position B from 196-curie Co^{60} source.

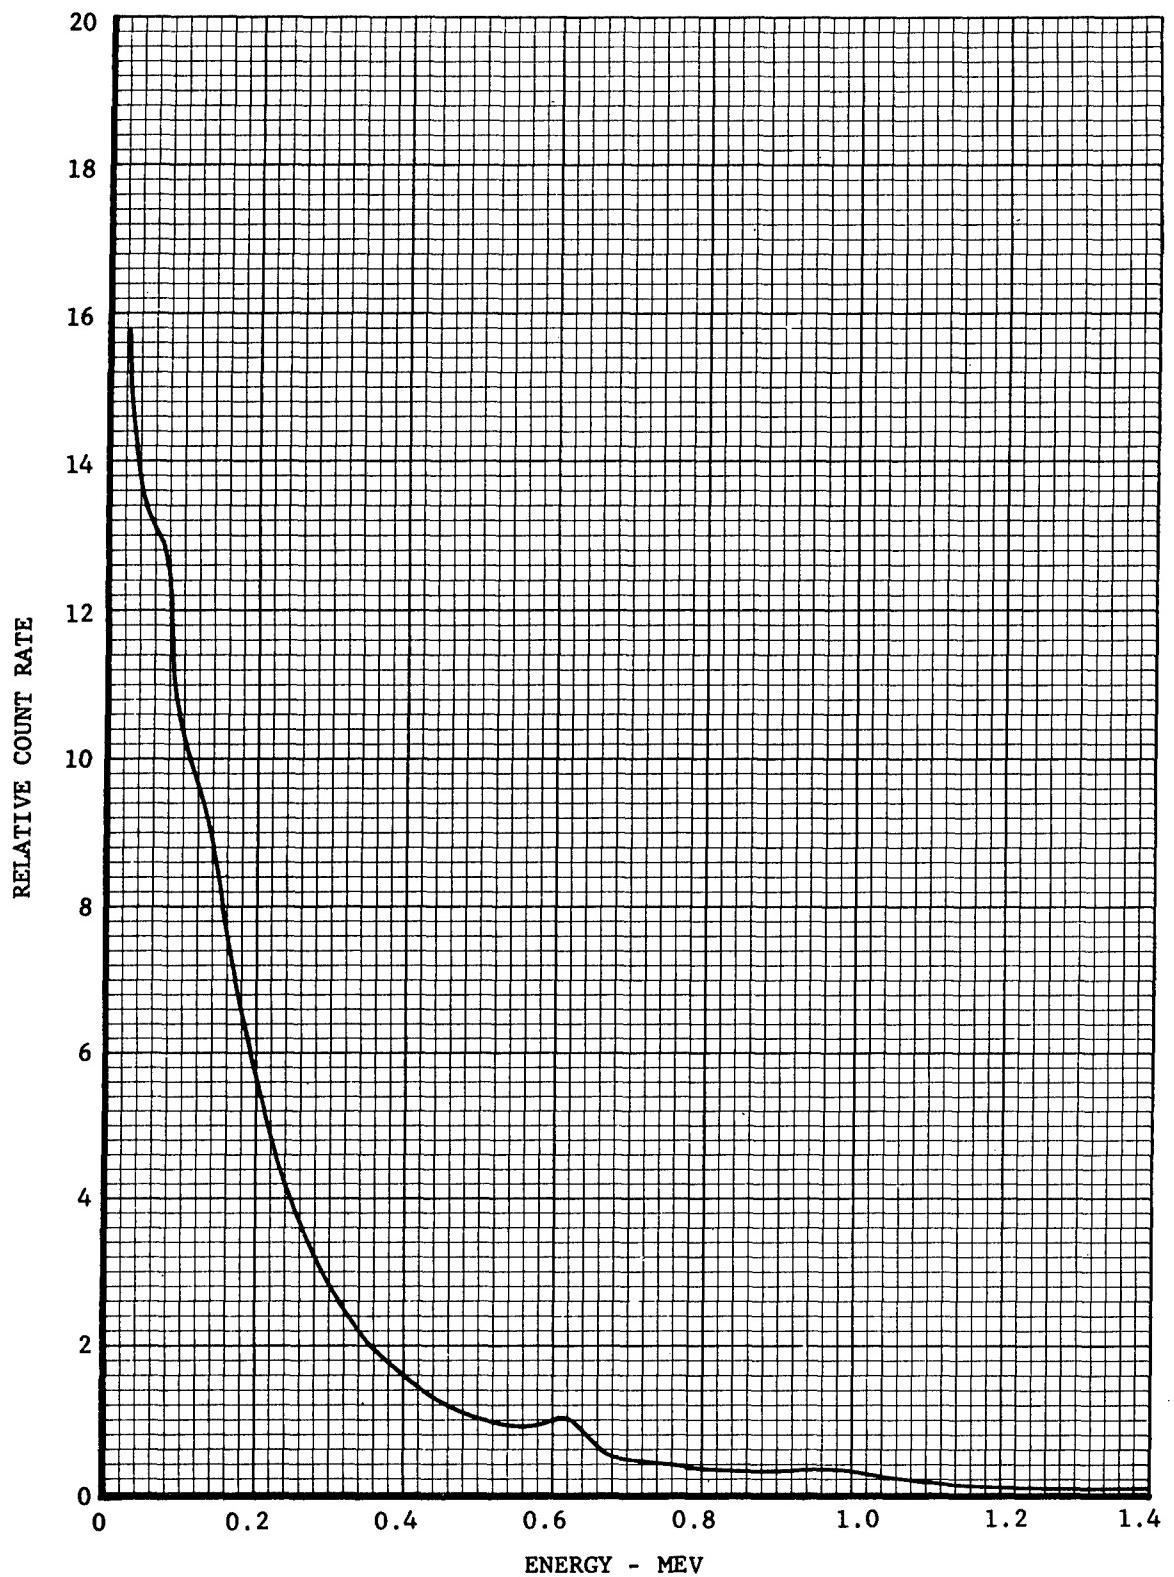


Fig. 3.5—Pulse-height distribution at position B from 16.3-curie Co^{60} source.

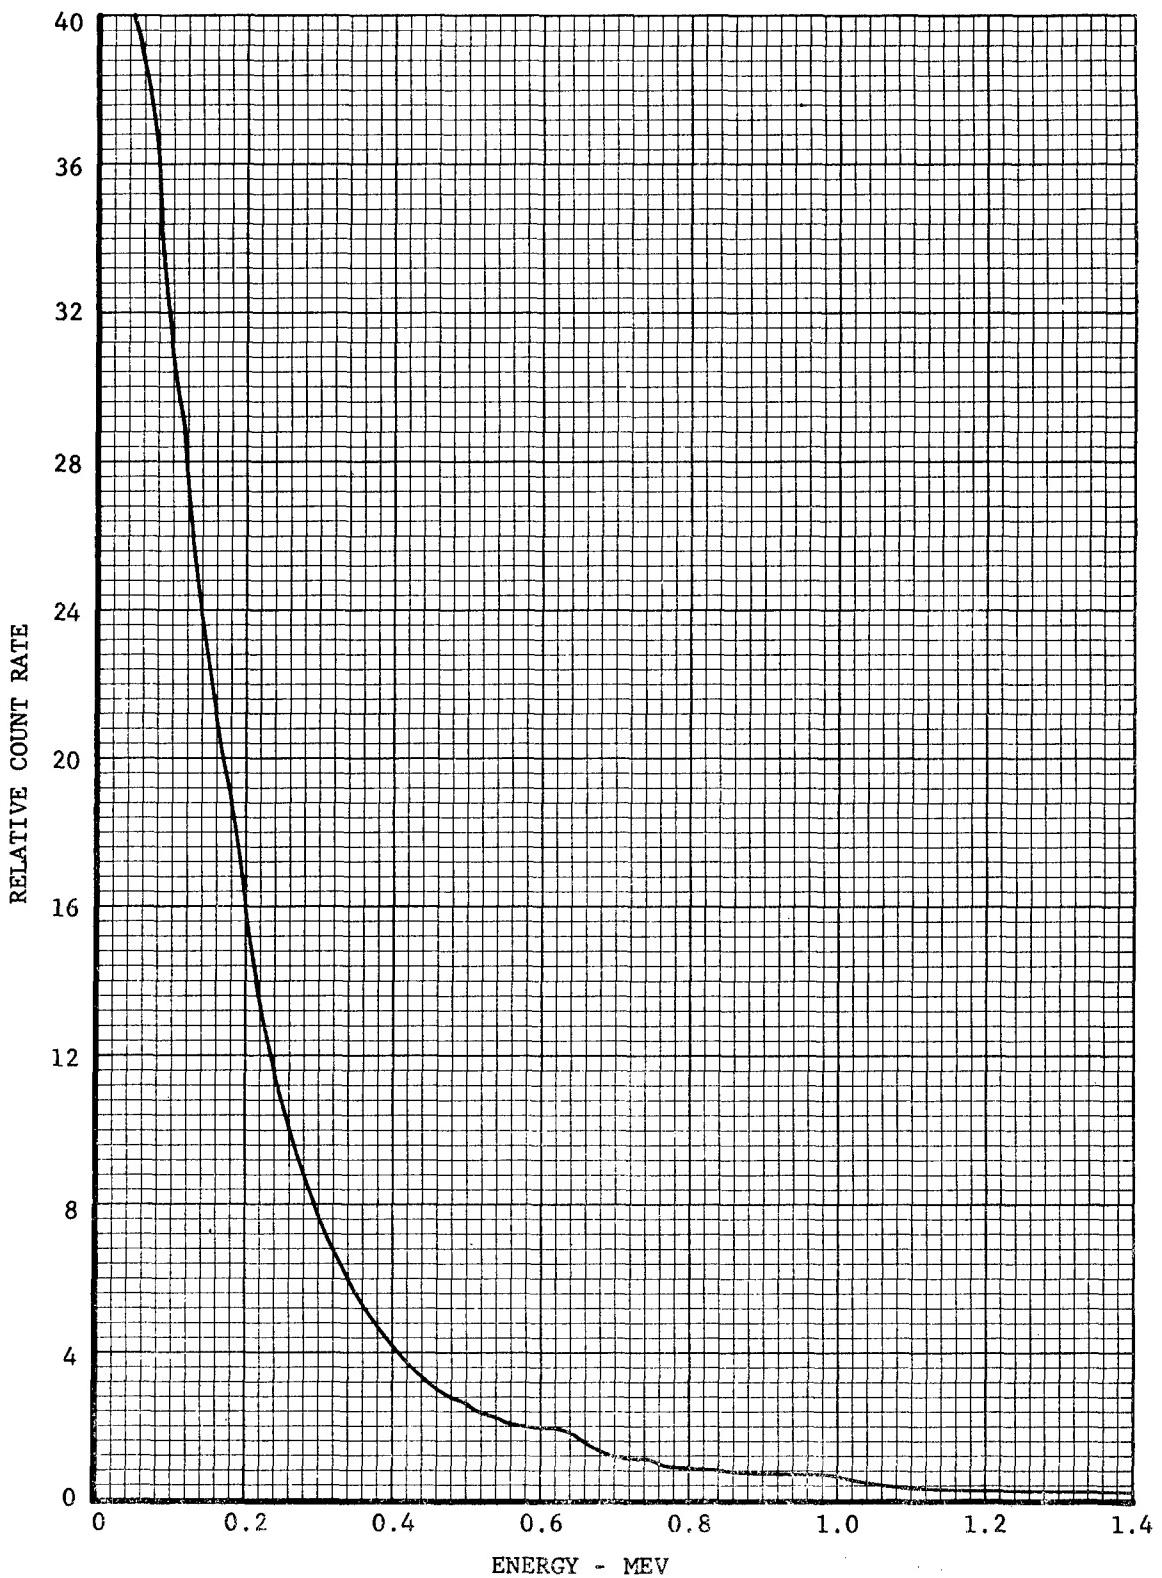


Fig. 3.6—Pulse-height distribution at position C from 16.3-curi e Co^{60} source.

Chapter 4

ANALYSIS AND CONCLUSIONS

4.1 GENERAL

The protection factor, P.F., at any point is defined as the ratio of the exposure dose rate, D_∞ , 3 ft above a smooth infinite plane uniformly contaminated with a radioactive material to the dose rate, D, inside the structure at the point in question when the structure (roof) and ground are covered by the same source distribution. Accordingly,

$$P.F. = \frac{D_\infty}{D}$$

Thus, a protection factor is a number indicating the protective value afforded by a structure; it provides a measure of how much less dose would be experienced inside the structure than outside in an unprotected area of the same radiation concentration.

To measure a protection factor with accuracy would require the simulation of fallout radiation on the structure and on the ground surrounding the structure out to an infinite distance. Since this is impractical, simulation in this experiment was limited to the immediate vicinity of the shelter. Fallout radiation was simulated directly over the shelter and on the ground outside out to about 15 ft from the edge of the shelter. The contribution from beyond the measurement area was not considered in determining the protection factors. This contribution may decrease the factor in the entranceways slightly but should not appreciably affect those inside the shelter proper.

Data taken during the experiment were corrected for leakage, temperature, pressure, and calibration. The corrected data were then normalized to milliroentgens per hour per millicurie per square foot by multiplying the true doses D_t (in milliroentgens) by the area A (in square feet) over which the tubing was distributed and dividing by the source strength S (in millicuries) and the exposure time T (in hours). Accordingly,

$$\text{Normalized data} = \frac{D_t A}{T S}$$

The protection factors were then obtained by dividing these normalized dose rates into the dose rate at a height of 3 ft above a smooth infinite plane of Co^{60} radiation uniformly contaminated to 1 mc/sq ft. This total infinite-plane dose rate has been evaluated in the literature¹⁻⁴ and is estimated to be 500 mr/hr.

The use of Co^{60} in simulating fallout radiation for shielding factors has been discussed in the literature.³ The protection factors for fission products and Co^{60} gamma radiation should compare to within 10 per cent.²

4.2 PROTECTION FACTORS

The protection factors were calculated according to the method presented in Sec. 4.1; the values for each detector position shown in Fig. 2.18 are given in Table 4.1. These factors plotted on a shelter floor plan appear in Fig. 4.1.

In general, the results indicate that the protection factor is approximately 5000 in the center of the shelter, increasing to 10,000 to 15,000 along the sides, and decreasing to about 3000 near the ends. Directly below the vents, the protection factor is approximately 2500 at the 3-ft level. The vent opening affects the protection factor only in a small area (less than 4-ft in diameter) directly below.

The protection factors were slightly more at the 1-ft level and slightly less at the 5- and 7-ft levels, except directly below the vents and near the ends of the shelter.

The reason for the rather high protection factors is the existence of an earth cover completely over the shelter, with a minimum thickness of 21 in. (measured at one point) on the top and increasing from 5 to 7 ft on the sides. In addition, the soil was relatively water soaked at the time of the test.

The protection factors tended to differ from point to point throughout the shelter, undoubtedly as a result of variations in the thickness of the earth cover. For instance, the area along the side and rear appeared to have a deeper than normal cover, and a high factor of 17,000 was noted at that point.

4.3 ENERGY MEASUREMENTS

Considerable scattering and resultant dose build-up occurs when a high-energy gamma flux is attenuated by a large thickness of material. For example, the dose build-up factor in 12 in. of concrete for an isotropic point source of 1-Mev incident gamma rays is about 8 (Gladys White, Report NBS-1003). This means that 7 times as much dose results from scattered gammas (less than 1 Mev) as from gammas of the original 1-Mev energy.

Therefore, the energy spectrum of the radiation entering the shelter was expected to differ considerably from the spectrum normally associated with Co⁶⁰.

The relative count rate rapidly increased at energies less than 100 kev (Fig. 3.1). Crystal assembly and associated analyzer characteristics were such that pulse pile-up from excessive rates caused erroneous counts to be registered in the energy range from 0 to 100 kev. As a result, no quantitative analysis of the spectrum in this energy range can be made.

A slight peak at about 630 kev appears in all the curves. After the experiment it was found that the emitter-follower unit in the preamplifier had a faulty transistor, which caused excessive shortening of the output pulse. This resulted in the linear amplifier's producing an erroneous peak at about 630 kev.

Figures 3.3 through 3.6 indicate that a major part of the radiation entering the shelter was degraded; it appeared to be considerably smaller than the 1.17- and 1.33-Mev energy peaks associated with Co⁶⁰. In fact, no Co⁶⁰ peaks were evident in any of the curves.

A quantitative analysis cannot be given because of two factors: (1) crystal efficiency was not known and (2) the analyzer was rate sensitive. That is, if the gamma flux is too high, the analyzer cannot accurately process all the pulses, and erroneous counts tend to register in the lower channels.

Calculation of the maximum dose rate at all positions (A, B, and C in Fig. 2.18) indicates that it may have exceeded the limit for proper analyzer counting action, even when the 16.3-curie source was used. However, the shapes of the curves in Fig. 3.3 through 3.6 are essentially the same, with no noticeable difference between sources or positions.

These results definitely show that, with the shielding used, there is a large build-up of scattered gamma rays of greatly reduced average energy. However, the difficulties of proper analyzer operation under the probable high-flux field conditions limit an accurate quantitative analysis of the data.

4.4 DISCUSSION AND GENERAL CONCLUSIONS

Accurate prediction of a fallout protection factor cannot be made easily because of the many unpredictable factors associated with a fallout situation. These unpredictable factors include the existence of nonuniformly contaminated areas and accumulation of fallout in entrance-ways. In addition, theoretical calculations become intricate and complicated when consideration is given to the existence of different shielding materials, ground contours, and complex shielding geometry. The protection factors determined during this experiment are based on simulation of a uniform fallout field. These values should represent good approximations of the real fallout protection factor since fallout, under idealized conditions, is uniformly deposited over large areas.

The protection factors were determined from the simulation of fallout radiation on and immediately surrounding the shelter. The contribution from beyond the area simulated would be small compared to the contribution from directly above the shelter. Consideration of the far-field contribution should not appreciably affect the values of the protection factors in the shelter proper.

In general, the shelter offers excellent protection from fallout radiation. The dose rate inside should be from 5000 to 15,000 times less than the dose rate 3 ft above the ground in an unprotected area, assuming the same source concentration. Variations in earth-cover thickness undoubtedly account for the different protection factors noted throughout.

The energy measurements demonstrated conclusively that there was a large build-up of scattered gamma rays of greatly reduced average energy with the shielding used. An accurate quantitative analysis of the data is, however, limited owing to the problems involved in proper analyzer operation under the probable high-flux field conditions.

Complete health physics procedures were followed during the experiment according to the radiological safety plan given in Appendix A. Maximum exposure to project personnel, as read by pocket ionization chambers, was less than 15 mr. Maximum exposure to supporting personnel was undetectable (less than 2 mr by pocket chambers).

REFERENCES

1. J. A. Auxier et al., *Experimental Evaluation of the Radiation Protection Afforded by Residential Structures Against Distributed Sources*, USAEC Report CEX-58.1, January 1959.
2. J. A. Auxier and T. D. Strickler, *Experimental Evaluation of the Radiation Protection Afforded by Typical Oak Ridge Homes Against Distributed Sources*, USAEC Report CEX-59.13, April 1960.
3. Charles Eisenhauer, *Analysis of Experiments on Light Residential Structures with Distributed Co⁶⁰ Sources*, Report NBS-6539, National Bureau of Standards, October, 1959.
4. J. H. Hubbell, *Dose Due to Distributed Gamma-ray Sources*, Report NBS-4928, National Bureau of Standards, November 1956. (Official Use Only).

Table 4.1—PROTECTION FACTORS AT POSITIONS IN THE SHELTER

Position	Protection factor				Position	Protection factor			
	At 1 ft	At 3 ft	At 5 ft	At 7 ft		At 1 ft	At 3 ft	At 5 ft	At 7 ft
1		240			21		5000	4700	4300
2		830			22		7200	7000	
3		1400			23	13000	15000		
4	5500	3400			24		13000		
5		2400	1600		25		7000	6200	
6		2700	1900	1800	26		5300	4900	4800
7		2500	1700		27		6200	6000	
8	7200	5900			28		17000		
9		8600			29		15000		
10		4200	3000		30		5100	5000	
11		3500	3200	3300	31		4200	4300	4600
12		4500	4400		32		6300	7200	
13		9000			33		12000		
14		11000			34	11000	12000		
15		5500	5500		35		5400	5600	
16		4500	4100	4100	36		2800	2200	1900
17		5800	5700		37		2400	1600	
18		13000			38	8600	6000		
19	13000	13000			39		410		
20		6200	6200		40		29		

Position	Protection factor			
	At 1 ft	At 3 ft	At 5 ft	At 7 ft
Below vent		2400	1900	1100
21 in. from center of vent		3700	3500	3500

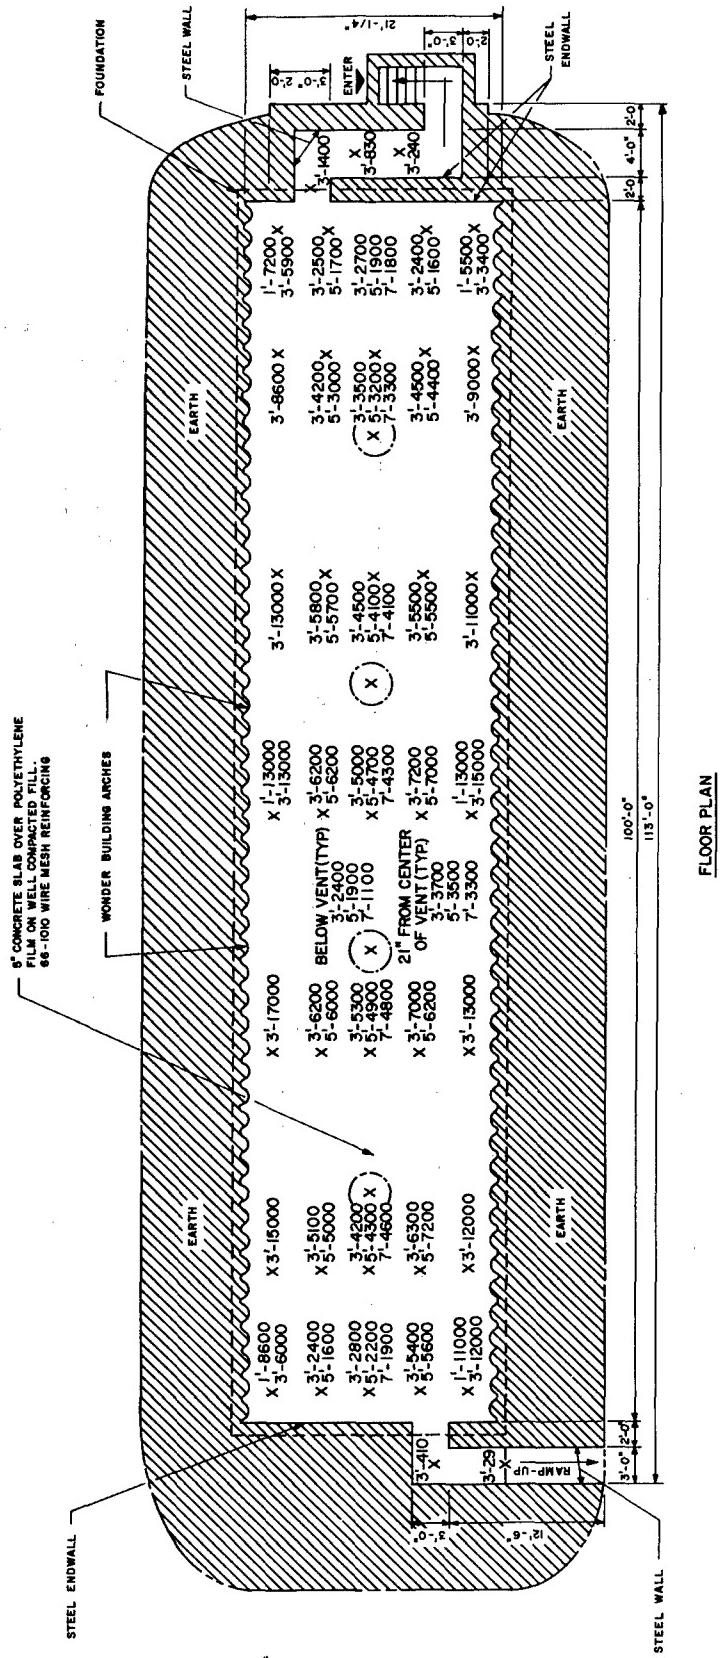


Fig. 4.1—Protection factors plotted on floor plan at different heights above floor.

Appendix A

RADIOLOGICAL-SAFETY OPERATIONS

This Appendix describes the radiation-safety operations carried out during the experimental survey of the earth-covered fallout shelter. The test was performed at night with minimum inconvenience and disruption in the normal activities of others in the area. No unusual incidents occurred, and the measurements were safely completed within the radiological-safety criteria established.

The day before the test, a radiological-safety plan was formulated. In general, this plan consisted in establishing restricted areas, placing radiation and road-block signs, issuing film badges and pocket chambers to appropriate personnel, and checking the test area continuously for unauthorized personnel during actual exposure.

Radiation-safety responsibility was shared by the local officials and the contracting agency performing the test (EG&G). A Radiological-safety Officer was appointed from each of the organizations. These officers were responsible for the safety of all personnel directly or indirectly associated with the test.

Responsibilities of those conducting the survey included the following:

1. Ensuring proper use and storage of all sources used
2. Issuing of film badges and pocket chambers
3. Reading of all film badges and pocket chambers
4. Ensuring that tests were started only after (1) a local official had reported that a restricted area had been established, that road blocks were set up and manned, and that the mobile patrol was in operation; and (2) that all buildings and the limited-access area had been visually inspected and no unauthorized personnel were present
5. Monitoring outlying security posts and other designated areas during the actual exposure
6. Monitoring the movement and physical location of all personnel within the restricted area during the radiation exposure
7. Being prepared for emergency radiological procedures
8. Maintaining an emergency operating plan
9. Notifying local representatives when the exposure was completed and the source was properly stored

The responsibility of the local authorities included the following:

1. Setting up and maintaining an outer-perimeter limited-access area from 11:00 p.m. October 14, until the test was finished and source secured
2. Limiting unauthorized access into the area adjacent to the shelter
3. Performing final visual inspection of all buildings, rooms, and areas within the enclosure to ensure that the premises had been completely evacuated
4. Moving the local Duty Officer to a nearby building prior to the exercise
5. Setting up communications between the control truck and the duty office

6. Making reports to the local Radiological-Safety Officer (1) that the limited access area had been established and manned and (2) that the restricted area had been visually inspected and that all unauthorized personnel had been evacuated

7. Reporting any unauthorized personnel in the limited-access area

8. Collecting and returning all film badges and pocket chambers issued to appropriate personnel

Complete health-physics procedures were followed during the experiment. Maximum exposure to project personnel as read by pocket chambers was less than 15 mr. Maximum exposure to all other personnel was undetectable (less than 2 mr by pocket chamber).

Appendix B

SAMPLE OF DATA, ANALYSIS, AND EVALUATION

Table B.1 presents a sample of the data from which protection factors were calculated. Reference is made to Chap. 4 in the main body of the report for amplification.

The protection factors, also shown in the table, were found by dividing the infinite-plane dose rate (500 mr/hr) by the normalized shelter dose rate (column 6).

Table B.1—CORRECTION AND NORMALIZATION OF DATA

Position	Average reading, mr	Corr. for background, mr	Corr. for temp. and pres., mr	Corr. for calib., mr	Normalization, mr/hr/mc/sq ft	P.F.
9	2.2	2.1	2.2	2.5	0.058	8600
10	4.4	4.3	4.4	5.1	0.118	4200
11	5.3	5.2	5.3	6.2	0.144	3500
12	4.1	4.0	4.1	4.8	0.111	4500

CIVIL EFFECTS TEST OPERATIONS REPORT SERIES (CEX)

Through its Division of Biology and Medicine and Civil Effects Test Operations Office, the Atomic Energy Commission conducts certain technical tests, exercises, surveys, and research directed primarily toward practical applications of nuclear effects information and toward encouraging better technical, professional, and public understanding and utilization of the vast body of facts useful in the design of countermeasures against weapons effects. The activities carried out in these studies do not require nuclear detonations.

A complete listing of all the studies now underway is impossible in the space available here. However, the following is a list of all reports available from studies that have been completed. All reports listed are available from the Office of Technical Services, Department of Commerce, Washington 25, D. C., at the prices indicated.

- CEX-57.1 The Radiological Assessment and Recovery of Contaminated Areas, Carl F. Miller, September 1960.
(\$0.75)
- CEX-58.1 Experimental Evaluation of the Radiation Protection Afforded by Residential Structures Against Distributed Sources, J. A. Auxier, J. O. Buchanan, C. Eisenhauer, and H. E. Menker, January 1959.
(\$2.75)
- CEX-58.2 The Scattering of Thermal Radiation into Open Underground Shelters, T. P. Davis, N. D. Miller, T. S. Ely, J. A. Basso, and H. E. Pearse, October 1959.
(\$0.75)
- CEX-58.7 AEC Group Shelter, AEC Facilities Division, Holmes & Narver, Inc., June 1960.
(\$0.50)
- CEX-58.8 Comparative Nuclear Effects of Biomedical Interest, Clayton S. White, I. Gerald Bowen, Donald R. Richmond, and Robert L. Corsbie, January 1961.
(\$1.00)
- CEX-58.9 A Model Designed to Predict the Motion of Objects Translated by Classical Blast Waves, I. Gerald Bowen, Ray W. Albright, E. Royce Fletcher, and Clayton S. White, June 1961.
(\$1.25)
- CEX-59.1 An Experimental Evaluation of the Radiation Protection Afforded by a Large Modern Concrete Office Building, J. F. Batter, Jr., A. L. Kaplan, and E. T. Clarke, January 1960.
(\$0.60)
- CEX-59.4 Aerial Radiological Monitoring System, I. Theoretical Analysis, Design, and Operation of a Revised System, R. F. Merian, J. G. Lackey, and J. E. Hand, February 1961.
(\$1.25)
- CEX-59.7C Methods and Techniques of Fallout Studies Using a Particulate Simulant, William Lee and Henry Borella, February 1962.
(\$0.50)
- CEX-59.13 Experimental Evaluation of the Radiation Protection Afforded by Typical Oak Ridge Homes Against Distributed Sources, T. D. Strickler and J. A. Auxier, April 1960.
(\$0.50)
- CEX-59.14 Determinations of Aerodynamic-drag Parameters of Small Irregular Objects by Means of Drop Tests, E. P. Fletcher, R. W. Albright, V. C. Goldizen, and I. G. Bowen, October 1961.
(\$1.75)
- CEX-60.1 Evaluation of the Fallout Protection Afforded by Brookhaven National Laboratory Medical Research Center, H. Borella, Z. Burson, and J. Jacovitch, February 1961.
(\$1.75)
- CEX-62.01 Technical Concept—Operation Bren, J. A. Auxier, F. W. Sanders, F. F. Haywood, J. H. Thorngate, and J. S. Cheka, January 1962.
(\$0.50)
- CEX-60.5 Experimental Evaluation of the Fallout-radiation Protection Afforded by a Southwestern Residence, Z. Burson, D. Parry, and H. Borella, February 1962.
(\$0.50)